

Appendix B – Self-Evaluation Results

At the time of the ROW inventories, the County was following general ADA design guidance and procedures. This included a commitment to providing access to all users but does not have a formal policy or procedure to assign priority regarding ADA accessibility issues within the County. Implementing a method to assign priority will be a part of this Plan effort.

Public Right-of-Way

Data Collection for the PAR/PCR (County) self-evaluation was completed in July 2020. The self-evaluation was performed by the County’s consultants. The detailed inventory is found in B-1.

This initial self-evaluation of PAR/PCR yielded the following results:

Figure 5. Self-Evaluation Results for Public Right-of-Way

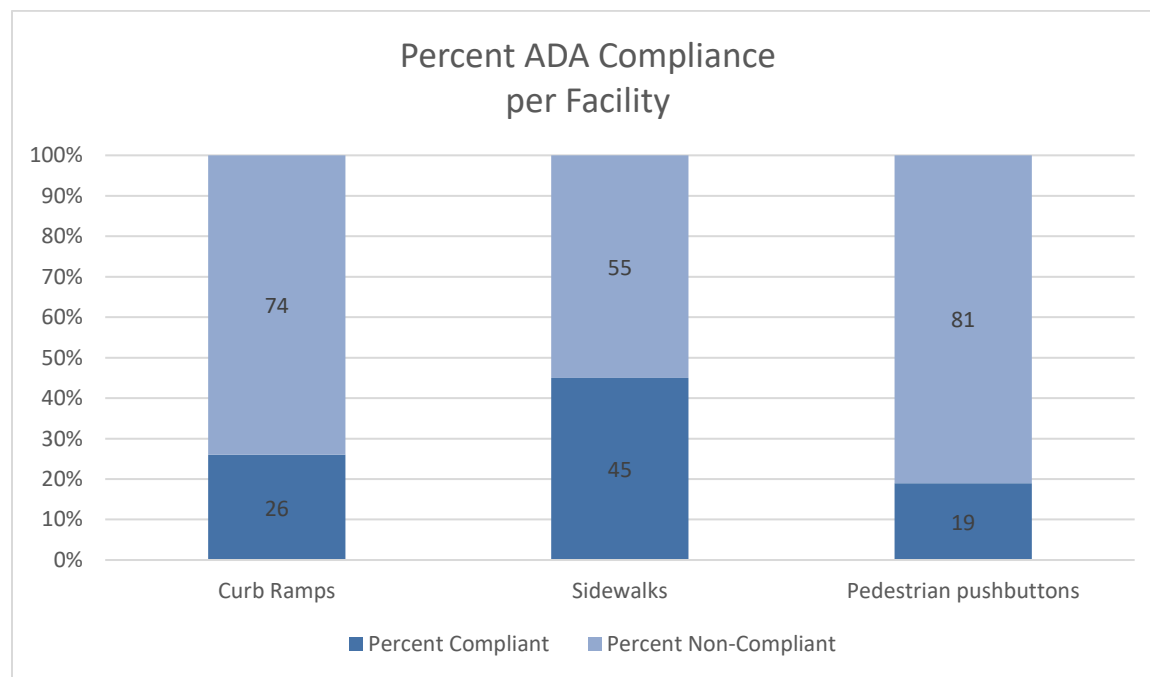


Chart Description: Twenty-six percent of curb ramps were ADA compliant. Forty-five percent of sidewalks were ADA compliant. Nineteen percent of pedestrian pushbuttons were ADA compliant.

B-1: Right-of-Way Self-Evaluation Inventory

OBJECTID	City	If walk/trail crosses curb, is there a curb ramp?	Is the Curb Ramp at a Driveway	Running slope <= 8.3%?	What is the running slope of the curb ramp?	Cross slope, excluding flares, <= 2%?	What is the cross slope of the curb ramp?	Curb ramp, excluding flares, at least 48in wide?	Landing >= 48in sq with cross slope <2% any dir?	What is the max landing slope?	Curb ramp flares slopes <= 10%?	Detectable warnings full width of the curb ramp?	Approx 75% of truncated domes in good condition?	Truncated domes contrast w/ adjacent surfaces?	Curb Ramp overall condition?	CR Characteristics	Notes	Compliant 1=Compliant
55	Blooming Prairie	Yes	Yes	Yes	2.3	No	2.7	Yes	Yes	2.0	N/A	N/A			Fair	Extensive cracking	No flares needed	0
56	Blooming Prairie	Yes	Yes	Yes	0.4	No	2.7	Yes	Yes	2.0	N/A	N/A			Fair	No flares needed		0
57	Blooming Prairie	No	No	Yes	0.0	1	0.4	Yes	Yes	0.4		No			Good	No flares		0
58	Blooming Prairie	Yes	No	No	10.3	1	1.1	No	Yes	1.9	No	No			Fair	Ponding		0
59	Blooming Prairie	Yes	No	No	12.7	1	0.6	Yes	Yes	1.7	No	No			Fair		Gap in elevation	0
60	Blooming Prairie	Yes	No	No	10.2	1	1.7	Yes	Yes	1.7	No	No			Good			0
61	Blooming Prairie	Yes	No	Yes	3.0	1	0.4	Yes	No	3.0		No			Fair	No flares	Some cracking	0
62	Blooming Prairie	Yes	No	Yes	4.8	No	2.5	Yes	Yes	2.0	No	No			Fair	Ponding	Some cracking	0
63	Blooming Prairie	Yes	No	Yes	8.3	1	1.9	Yes	Yes	2.0	No	No	Yes	Yes	Good		Small gap	0
64	Blooming Prairie	Yes	No	Yes	3.9	1	1.4	Yes	Yes	2.0	No	Yes	Yes	Yes	Good			0
65	Blooming Prairie	No	No	Yes	1.9	1	0.1	Yes	Yes	1.9		No			Good	No flares		0
66	Blooming Prairie	Yes	No	Yes	1.9	1	0.8	Yes	Yes	1.9	No	Yes	Yes	Yes	Good			0
67	Blooming Prairie	Yes	No	Yes	5.5	1	0.8	Yes	Yes	1.5	No	Yes	Yes	Yes	Good			0
68	Blooming Prairie	Yes	No	Yes	5.5	No	2.1	Yes	Yes	1.0	No	Yes	Yes	Yes	Fair	Ponding		0
69	Blooming Prairie	Yes	No	Yes	4.2	1	0.4	Yes	Yes	1.0	No	Yes	Yes	Yes	Good			0
70	Blooming Prairie	Yes	No	No	15.3	1	1.1	No	Yes	1.2		No			Poor	Ponding	Elevation gap	0
71	Blooming Prairie	No	No	Yes	0.4	1	1.1	No	Yes	1.1		No			Fair	Ponding		0
72	Blooming Prairie	No	No	Yes	4.7	1	1.2	No	Yes	1.5		No			Fair	No flares	Ponding	0
73	Blooming Prairie	Yes	No	No	18.2	1	0.9	No	Yes	1.4	No	No			Fair	Ponding	Elevation gap	0
74	Blooming Prairie	Yes	No	No	17.5	1	0.4	No	Yes	1.8	No	No			Fair	Some cracking	Elevation gap	0
75	Blooming Prairie	No	No	Yes	6.5	1	2.0	Yes	Yes	1.8		No			Fair	No flares		0
76	Blooming Prairie	No	No	Yes	0.8	1	2.0	Yes	Yes	2.0		No			Poor	Ponding		0
77	Blooming Prairie	Yes	No	No	12.0	1	0.7	Yes	Yes	1.8	No	No			Fair	Ponding	Elevation Gap	0
78	Blooming Prairie	Yes	No	No	12.8	No	2.8	No	Yes	2.0	No	No			Good	Some cracking		0
79	Blooming Prairie	No	No	Yes	3.5	1	1.5	Yes	Yes	2.0		No			Fair	No flares	Ponding and vegetation	0
80	Blooming Prairie	Yes	Yes	Yes	3.0	No	3.8	No	No	3.0		N/A			Good			0
81	Blooming Prairie	Yes	Yes	Yes	1.8	No	3.0	No	No	3.0		N/A			Fair	Some vegetation	Driveway	0
82	Blooming Prairie	Yes	Yes	Yes	2.9	No	5.8	No	No	3.6		N/A			Poor	Some ponding and vegetation		0
83	Blooming Prairie	Yes	Yes	Yes	1.2	No	3.9	Yes	No	3.9		N/A			Poor	Ponding	Sidewalk just disappears????	0
84	Blooming Prairie	Yes	No	No	12.5	1	1.5	Yes	Yes	1.9	No	No			Good			0
85	Blooming Prairie	Yes	No	No	11.6	1	0.0	Yes	Yes	1.9	No	No			Poor	Ponding		0
86	Blooming Prairie	Yes	No	No	11.0	No	3.1	Yes	No	2.2	No	No			Fair		Elevation Gap	0
87	Blooming Prairie	Yes	No	No	11.1	No	5.3	Yes	No	4.2	No	No			Fair	Some ponding and vegetation		0
88	Blooming Prairie	Yes	Yes	Yes	1.1	1	1.6	Yes	Yes	1.1		N/A			Good	No flares needed		1
89	Blooming Prairie	Yes	Yes	Yes	3.6	No	7.7	Yes	No	4.2		N/A			Fair	Ponding	Elevation gap	0
90	Blooming Prairie	Yes	Yes	Yes	3.4	0	11.2	Yes	No	8.7		N/A			Good	No flares needed		0
91	Blooming Prairie	Yes	Yes	Yes	6.8	No	6.1	Yes	No	3.4		N/A			Good	No flares needed		0
92	Blooming Prairie	Yes	Yes	Yes	5.2	No	6.3	Yes	No	3.3		N/A			Good	No flares needed		0
93	Blooming Prairie	Yes	Yes	Yes	4.5	No	5.7	Yes	No	5.9		N/A			Good	No flares needed		0
94	Blooming Prairie	Yes	No	Yes	0.3	No	2.9	Yes	Yes	1.7	Yes	Yes	Yes	Yes	Good			0
95	Blooming Prairie	Yes	No	Yes	0.0	1	1.0	Yes	Yes	1.0	Yes	Yes	Yes	Yes	Fair	Ponding		1
96	Blooming Prairie	Yes	No	Yes	1.6	1	0.1	Yes	Yes	1.6	Yes	Yes	Yes	Yes	Good	Ponding		1
97	Blooming Prairie	Yes	No	Yes	1.7	1	0.6	Yes	Yes	1.7	Yes	Yes	Yes	Yes	Fair	Ponding		1
98	Blooming Prairie	No	No	Yes	2.2	No	2.1	No	No	2.2		No			Good			0
99	Blooming Prairie	Yes	No	Yes	6.4	1	0.9	Yes	Yes	1.3	No	No			Good	Some vegetation		0
100	Blooming Prairie	Yes	No	Yes	6.0	1	0.0	Yes	Yes	1.0	No	No			Fair	Ponding	Elevation gap	0
101	Blooming Prairie	Yes	No	Yes	5.7	1	1.4	Yes	Yes	0.4	No	No			Fair	Ponding		0
102	Blooming Prairie	Yes	No	Yes	6.4	1	1.8	Yes	Yes	1.2	Yes	No			Fair	Ponding	Elevation Gap	0
103	Blooming Prairie	No	No	Yes	3.4	1	0.5	Yes	Yes	2.0		No			Good	No flares		0
104	Blooming Prairie	Yes	No	Yes	3.8	1	0.5	Yes	Yes	0.9	Yes	Yes	Yes	Yes	Good	Ponding		1
105	Blooming Prairie	Yes	No	Yes	3.1	1	0.4	Yes	Yes	0.9	Yes	Yes	Yes	Yes	Fair	Ponding		1
106	Blooming Prairie	Yes	No	Yes	1.1	1	0.0	Yes	Yes	1.1	Yes	Yes	Yes	Yes	Good	Ponding		1
107	Blooming Prairie	Yes	No	Yes	2.7	1	0.0	Yes	Yes	0.8	Yes	Yes	Yes	Yes	Fair	Some ponding and vegetation		1
108	Blooming Prairie	Yes	No	Yes	3.3	1	1.1	Yes	Yes	0.4	Yes	Yes	Yes	Yes	Good	Ponding		1
109	Blooming Prairie	Yes	No	Yes	1.3	1	0.6	Yes	Yes	1.3	Yes	Yes	Yes	Yes	Fair	Ponding		1
110	Blooming Prairie	Yes	No	Yes	4.1	1	0.4	Yes	Yes	0.3	Yes	Yes	Yes	Yes	Good			1
111	Blooming Prairie	Yes	No	Yes	2.3	1	0.3	Yes	Yes	0.3	Yes	Yes	Yes	Yes	Good	Ponding		1
112	Blooming Prairie	Yes	No	Yes	3.0	1	0.3	Yes	Yes	0.7	Yes	Yes	Yes	Yes	Good	Ponding		1
113	Blooming Prairie	Yes	No	Yes	1.3	1	1.2	Yes	Yes	1.2	Yes	Yes	Yes	Yes	Good			1
114	Blooming Prairie	Yes	No	Yes	5.5	1	0.1	Yes	Yes	1.2	Yes	No			Fair	Ponding		0
115	Blooming Prairie	Yes	No	Yes	1.9	1	0.2	Yes	Yes	1.9	Yes	Yes	Yes	Yes	Good	Ponding		1
116	Blooming Prairie	Yes	No	Yes	3.1	1	0.0	Yes	Yes	0.6	Yes	Yes	Yes	Yes	Good	Ponding		1
117	Blooming Prairie	Yes	No	Yes	3.4	1	0.6	Yes	Yes	1.1	Yes	Yes	Yes	Yes	Good	Some ponding and vegetation		1
118	Blooming Prairie	Yes	No	Yes	0.6	1	1.1	Yes	Yes	1.1	Yes	Yes	Yes	Yes	Good			1
119	Blooming Prairie	Yes	No	Yes	5.0	1	1.0	Yes	Yes	1.0	Yes	Yes	Yes	Yes	Good			1
120	Blooming Prairie	Yes	No	Yes	1.8	1	0.3	Yes	Yes	1.8	Yes	Yes	Yes	Yes	Good	Ponding		1
121	Blooming Prairie	Yes	No	Yes	0.8	1	1.0	Yes	Yes	1.0	Yes	Yes	Yes	Yes	Good			1
122	Blooming Prairie	Yes	No	Yes	0.6	1	0.1	Yes	Yes	0.6	Yes	Yes	Yes	Yes	Good	Some ponding and vegetation		1
123	Blooming Prairie	No	Yes	Yes	3.5	1	1.6	Yes	Yes	0.9	Yes	Yes	Yes	Yes	Good	Ponding		0
124	Blooming Prairie	Yes	No	Yes	4.8	1	1.1	Yes	Yes	0.9	No	Yes	Yes	Yes	Fair	Ponding		0
125	Blooming Prairie	Yes	No	Yes	2.3	1	0.3	Yes	Yes	0.7	Yes	Yes	Yes	Yes	Fair	Some ponding and vegetation		1
126	Blooming Prairie	Yes	No	Yes	4.1	1	0.8	Yes	Yes	0.7	Yes	Yes	Yes	Yes	Fair	Ponding		1
127	Blooming Prairie	Yes	No	Yes	0.1	1	0.1	Yes	Yes	0.8		Yes	Yes	Yes	Good			1
128	Blooming Prairie	Yes	No	Yes	0.1	1	0.7	Yes	Yes	0.7		Yes	Yes	Yes	Good			1
129	Blooming Prairie	Yes	No	Yes	0.8	1	1.0	Yes	Yes	1.0	Yes	Yes	Yes	Yes	Fair	Ponding		1
130	Blooming Prairie	Yes	No	Yes	2.6	No	2.3	Yes	Yes	0.8	Yes	Yes	Yes	Yes	Fair	Ponding		0
131	Blooming Prairie	Yes	No	Yes	3.2	1	0.9	Yes	Yes	0.8	Yes	Yes	Yes	Yes	Good	Ponding		1
132	Blooming Prairie	Yes	No	Yes	0.9	1	1.3	Yes	Yes	1.3	Yes	Yes	Yes	Yes	Good	Ponding		1
133	Blooming Prairie	Yes	No	Yes	2.6	1	0.1	Yes	Yes	1.2	Yes	Yes	Yes	Yes	Fair	Ponding		1
134	Blooming Prairie	Yes	No	Yes	3.5	1	0.1	Yes	Yes	0.7	Yes	Yes	Yes	Yes	Good	Ponding		1
135	Blooming Prairie	Yes	No	Yes	1.7	1	0.2	Yes	Yes	1.7	Yes	Yes	Yes	Yes	Good	Ponding		1

OBJECTID	City	If walk/trail crosses curb, is there a curb ramp?	Is the Curb Ramp at a Driveway	Running slope <= 8.3%?	What is the running slope of the curb ramp?	Cross slope, excluding flares, <= 2%?	What is the cross slope of the curb ramp?	Curb ramp, excluding flares, at least 48in wide?	Landing >= 48in sq with cross slope <2% any dir?	What is the max landing slope?	Curb ramp flares slopes <= 10%?	Detectable warnings full width of the curb ramp?	Approx 75% of truncated domes in good condition?	Truncated domes contrast w/ adjacent surfaces?	Curb Ramp overall condition?	CR Characteristics	Notes	Compliant 1=Compliant
136	Bloomington	Yes	No	Yes	5.5	1	1.3	Yes	Yes	1.6	Yes	Yes	Yes	Yes	Good	Ponding		1
137	Bloomington	Yes	No	Yes	1.7	1	0.3	Yes	Yes	1.7	Yes	Yes	Yes	Yes	Good			1
138	Bloomington	Yes	No	Yes	1.9	1	0.3	Yes	Yes	1.9	Yes	Yes	Yes	Yes	Good			1
139	Bloomington	Yes	No	Yes	3.4	1	0.7	Yes	Yes	0.9	Yes	Yes	Yes	Yes	Fair	Ponding		1
140	Bloomington	Yes	No	Yes	3.6	1	0.3	Yes	Yes	0.9	Yes	Yes	Yes	Yes	Good			1
141	Bloomington	No	No	Yes	3.2	1	1.0	Yes	Yes	1.2		No			Good	Some vegetation		0
142	Bloomington	Yes	No	Yes	4.0	1	0.5	Yes	Yes	1.0	Yes	Yes	Yes	Yes	Good	Some ponding and vegetation		1
143	Bloomington	Yes	No	Yes	3.3	1	0.6	Yes	Yes	1.1	Yes	Yes	Yes	Yes	Good			1
144	Bloomington	Yes	No	Yes	3.3	1	0.4	Yes	Yes	0.7	Yes	Yes	Yes	Yes	Good	Ponding		1
145	Bloomington	Yes	No	Yes	3.6	1	0.7	Yes	Yes	0.7	Yes	Yes	Yes	Yes	Good	Ponding		1
146	Bloomington	No	No	Yes	3.0	1	0.5	Yes	Yes	0.5		No			Good	No flares		0
147	Bloomington	No	No	Yes	0.7	0	0.2	Yes	Yes	0.7		No			Good			0
148	Bloomington	Yes	No	Yes	3.1	1	0.3	Yes	Yes	0.7	Yes	Yes	Yes	Yes	Good			1
149	Bloomington	Yes	No	Yes	1.0	1	0.4	Yes	Yes	1.0	Yes	Yes	Yes	Yes	Good			1
150	Bloomington	Yes	No	Yes	2.7	1	0.4	Yes	Yes	0.8	Yes	Yes	Yes	Yes	Good			1
276	Bloomington	Yes	No	Yes	4.5	1	0.9	No	Yes	0.8	No	No			Fair	Some cracking		0
277	Bloomington	Yes	Yes	Yes	0.9	1	0.1	Yes	Yes	0.9	Yes	N/A			Poor	Extensive cracking	Only flare on one side	0
278	Bloomington	Yes	Yes	Yes	0.5	1	1.1	Yes	Yes	1.1	Yes	N/A			Fair		Gap in elevation	1
279	Bloomington	Yes	No	Yes	3.4	1	0.2	Yes	Yes	0.9	Yes	No			Fair	Some ponding and vegetation		0
280	Bloomington	Yes	No	No	8.8	1	0.8	Yes	Yes	0.9	No	No			Fair	Some ponding and vegetation	Gap in elevation	0
281	Bloomington	Yes	No	Yes	4.7	1	1.3	Yes	Yes	0.2	No	No			Fair	Heavy vegetation		0
282	Bloomington	Yes	No	Yes	5.5	1	0.7	Yes	Yes	0.2	No	No			Good	Some vegetation		0
283	Bloomington	Yes	Yes	Yes	0.0	1	0.9	Yes	Yes	0.8	Yes	N/A			Fair	Some vegetation	Only one flare, small gap in elevation	1
284	Bloomington	Yes	Yes	Yes	0.5	1	0.5	Yes	Yes	0.6	Yes	N/A			Fair	Some ponding and vegetation		1
285	Bloomington	No	No	Yes	0.4	1	0.9	Yes	Yes	0.9		No			Fair	Heavy vegetation		0
286	Bloomington	Yes	No	No	10.1	1	0.5	Yes	Yes	0.1	No	No			Fair	Heavy vegetation		0
287	Bloomington	Yes	No	Yes	5.8	1	0.8	Yes	Yes	0.5	No	No			Good			0
288	Bloomington	No	No	Yes	0.1	1	0.0	Yes	Yes	0.1		No			Good	No flares		0
289	Bloomington	Yes	No	Yes	5.7	1	0.6	Yes	No	2.6	Yes	No	Yes	Yes	Good			0
290	Bloomington	Yes	No	Yes	4.0	1	0.5	Yes	Yes	0.6	Yes	No	Yes	Yes	Fair	Some vegetation		0
291	Bloomington	Yes	No	Yes	5.1	No	4.8	Yes	Yes	1.3	Yes	No			Fair	Some cracking and vegetation		0
292	Bloomington	Yes	No	Yes	3.8	1	1.1	Yes	Yes	1.7	No	No			Fair	Ponding		0
293	Bloomington	Yes	No	Yes	6.5	1	0.9	Yes	Yes	0.5		No			Poor	Ponding	Gap in elevation	0
294	Bloomington	Yes	No	Yes	0.5	1	1.2	Yes	Yes	1.2		No			Fair	Some cracking and vegetation	No flares	0
295	Bloomington	Yes	Yes	Yes	1.5	No	2.4	Yes	No	2.4		N/A			Fair	Ponding		0
296	Bloomington	Yes	Yes	Yes	0.0	1	1.6	Yes	Yes	1.6		N/A			Fair	No flares needed	Ponding	1
297	Bloomington	Yes	No	Yes	5.3	1	0.7	Yes	Yes	1.9	Yes	No			Poor	Heavy vegetation	Appears to only have 1 flare	0
298	Bloomington	Yes	No	Yes	1.5	No	3.8	No	Yes	1.9	No	No			Poor	Ponding		0
299	Bloomington	Yes	Yes	Yes	1.9	1	1.6	No	Yes	1.6		N/A			Fair	Some vegetation		0
300	Bloomington	Yes	Yes	Yes	4.6	1	1.1	Yes	Yes	1.0		N/A			Good			1
301	Bloomington	Yes	No	Yes	2.7	No	3.3	Yes	No	2.7	Yes	No	Yes	Yes	Good	Some vegetation		0
262	Ellendale	Yes	Yes	Yes	7.1	No	5.9	Yes	No	7.1		N/A			Good	No flares needed		0
263	Ellendale	Yes	Yes	Yes	2.2	1	2.0	Yes	No	2.2		N/A			Good	No flares needed		0
264	Hope	Yes	Yes	Yes	0.9	No	2.7	Yes	Yes	0.7		N/A			Good	No flares needed	Some vegetation	0
265	Hope	Yes	Yes	Yes	0.3	No	3.5	Yes	No	2.6		N/A			Good	No flares needed		0
266	Hope	Yes	Yes	Yes	2.4	No	2.1	Yes	Yes	1.6		N/A			Good	No flares needed	Some vegetation	0
267	Hope	Yes	Yes	Yes	2.8	1	1.7	Yes	Yes	0.8		N/A			Good	No flares needed	Some vegetation	1
268	Hope	Yes	No	Yes	3.4	1	0.2	Yes	Yes	1.0	Yes	No			Fair	Ponding		0
269	Hope	Yes	Yes	Yes	2.7	1	1.9	Yes	Yes	1.9		N/A			Good	No flares needed		1
270	Hope	Yes	Yes	Yes	1.6	1	1.5	Yes	Yes	1.6		N/A			Good	No flares needed	Some vegetation	1
271	Hope	Yes	Yes	Yes	1.8	1	1.9	Yes	Yes	1.9		N/A			Good	No flares needed	Some vegetation	1
272	Hope	Yes	Yes	Yes	1.9	No	2.2	Yes	Yes	1.7		N/A			Good	No flares needed	Some vegetation	0
273	Hope	Yes	Yes	Yes	4.2	1	1.8	Yes	N/A	N/A		N/A			Good	No flares needed		1
274	Hope	Yes	Yes	Yes	1.7	No	3.6	Yes	No	2.5		N/A			Good	No flares needed	Some ponding	0
275	Hope	Yes	No	Yes	1.8	1	0.2	Yes	Yes	1.8	Yes	No			Fair	Some ponding and vegetation		0
4	Medford	Yes	No	Yes	0.3	1	1.5	Yes	Yes	1.5	Yes	Yes	Yes	Yes	Good	Some vegetation		1
5	Medford	Yes	No	Yes	0.5	1	0.9	Yes	Yes	0.9	Yes	Yes	Yes	Yes	Good	Some ponding and vegetation		1
6	Medford	Yes	No	Yes	1.2	1	1.0	Yes	Yes	1.2	Yes	Yes	Yes	Yes	Good			1
7	Medford	Yes	No	Yes	0.9	1	1.9	Yes	Yes	1.9	Yes	Yes	Yes	Yes	Good	Some vegetation		1
8	Medford	Yes	Yes	Yes	3.7	1	1.1	Yes	Yes	1.3		N/A			Good			1
9	Medford	Yes	Yes	Yes	2.4	1	1.6	Yes	Yes	1.6		N/A			Good			1
10	Medford	Yes	No	Yes	0.9	1	1.3	Yes	Yes	1.3	Yes	Yes	Yes	Yes	Good			1
11	Medford	Yes	No	Yes	0.6	1	1.8	Yes	Yes	1.8	Yes	Yes	Yes	Yes	Good			1
12	Medford	Yes	Yes	Yes	0.1	1	0.9	Yes	Yes	0.9	Yes	Yes	Yes	Yes	Good	Ponding		1
13	Medford	Yes	No	Yes	0.7	1	1.3	Yes	Yes	1.3	Yes	Yes	Yes	Yes	Good			1
14	Medford	Yes	No	Yes	8.3	1	0.8	Yes	Yes	2.0	Yes	Yes	Yes	Yes	Fair	Some ponding and vegetation		1
15	Medford	Yes	No	Yes	1.5	1	1.4	Yes	Yes	1.5	Yes	Yes	Yes	Yes	Poor	Some ponding and vegetation		0
16	Medford	Yes	No	Yes	0.1	1	1.2	Yes	Yes	1.2	No	Yes	Yes	Yes	Good	Some vegetation		0
17	Medford	Yes	No	Yes	1.5	1	0.2	Yes	Yes	1.5	No	Yes	Yes	Yes	Good	Some ponding and vegetation		0
18	Medford	Yes	No	Yes	0.2	1	0.8	Yes	Yes	0.8	No	Yes	Yes	Yes	Fair	Heavy vegetation		0
19	Medford	Yes	No	Yes	6.6	1	0.4	Yes	Yes	1.2	No	Yes	Yes	Yes	Good	Some vegetation	Median	0
20	Medford	Yes	No	Yes	0.2	1	1.4	Yes	Yes	1.2	No	Yes	Yes	Yes	Fair	Ponding		0
21	Medford	Yes	No	Yes	5.5	1	0.1	Yes	Yes	1.5	No	Yes	Yes	Yes	Fair	Some ponding and vegetation		0
22	Medford	Yes	No	Yes	1.9	1	1.0	Yes	Yes	1.9	No	Yes	Yes	Yes	Poor	Some ponding and vegetation		0
23	Medford	Yes	No	Yes	2.7	1	1.6	Yes	No	2.7		No			Good			0
24	Medford	Yes	No	Yes	2.7	1	1.5	Yes	No	2.7	No	No			Good			0
25	Medford	Yes	No	Yes	1.9	1	0.7	Yes	Yes	1.9	No	Yes	Yes	Yes	Fair	Heavy vegetation		0
26	Medford	Yes	No	Yes	5.0	1	0.8	Yes	No	4.0	Yes	No			Fair	Some ponding and vegetation		0
27	Medford	Yes	No	Yes	1.0	1	1.5	Yes	Yes	1.5	No	Yes	Yes	Yes	Poor	Some ponding and vegetation		0
28	Medford	Yes	No	Yes	0.4	1	1.1	Yes	Yes	1.1	No	Yes	Yes	Yes	Good	Some ponding and vegetation		0
29	Medford	Yes	No	Yes	0.2	1	0.2	Yes	Yes	0.2	No	Yes	Yes	Yes	Fair	Ponding		0

OBJECTID	City	If walk/trail crosses curb, is there a curb ramp?	Is the Curb Ramp at a Driveway	Running slope <= 8.3%?	What is the running slope of the curb ramp?	Cross slope, excluding flares, <= 2%?	What is the cross slope of the curb ramp?	Curb ramp, excluding flares, at least 48in wide?	Landing >= 48in sq with cross slope <2% any dir?	What is the max landing slope?	Curb ramp flares slopes <= 10%?	Detectable warnings full width of the curb ramp?	Approx 75% of truncated domes in good condition?	Truncated domes contrast w/ adjacent surfaces?	Curb Ramp overall condition?	CR Characteristics	Notes	Compliant 1=Compliant
30	Medford	Yes	No	Yes	2.4	1	0.2	Yes	Yes	1.3	No	Yes	Yes	Yes	Poor	Ponding	complain about large gap in sidewalk and said the it caused d	0
31	Medford	Yes	No	Yes	1.0	No	2.6	Yes	Yes	2.0	Yes	Yes	Yes	Yes	Good	Ponding		0
32	Medford	Yes	Yes	Yes	4.0	No	2.8	Yes	Yes	1.7		N/A			Good	No flares needed		0
33	Medford	Yes	Yes	Yes	1.6	No	3.0	Yes	Yes	2.0		N/A			Good			0
34	Medford	Yes	No	Yes	5.8	No	8.0	Yes	Yes	2.0	No	No			Fair	Ponding		0
35	Medford	Yes	No	No	11.2	No	7.6	Yes	Yes	1.6	No	No			Poor	Some ponding and vegetation		0
36	Medford	Yes	No	Yes	0.5	1	0.4	Yes	Yes	0.5	No	No			Poor	No flares		0
37	Medford	Yes	No	No	9.8	1	1.0	Yes	Yes	2.0	Yes	Yes	Yes	Yes	Fair		Gap in curb	0
38	Medford	Yes	No	Yes	4.2	1	1.6	Yes	Yes	1.7	Yes	Yes	Yes	Yes	Fair	Ponding		1
39	Medford	Yes	No	Yes	5.7	1	0.5	Yes	Yes	1.8	No	No			Fair	Some ponding and vegetation		0
40	Medford	Yes	No	Yes	5.8	1	0.6	Yes	Yes	1.8	No	No			Poor	Some ponding and vegetation		0
41	Medford	Yes	No	No	9.9	No	2.2	No	Yes	1.6	No	No			Fair	Some vegetation		0
42	Medford	Yes	No	No	11.5	1	1.8	Yes	Yes	1.3	No	No			Fair	Some ponding and vegetation		0
43	Medford	Yes	No	Yes	19.2	1	0.1	Yes	Yes	0.7	No	No			Poor	Some ponding and vegetation		0
44	Medford	Yes	No	No	13.6	1	1.4	Yes	Yes	0.7	No	No			Fair	Some vegetation		0
45	Medford	Yes	No	No	16.1	1	1.2	No	N/A	N/A	No	No			Poor	Dirt	Grass	0
46	Medford	Yes	No	No	9.2	No	3.1	No	Yes	1.4	No	No			Good	Some vegetation		0
47	Medford	Yes	No	No	10.8	No	5.1	Yes	Yes	1.9	No	No			Poor	Extensive cracking		0
48	Medford	Yes	No	No	12.5	No	3.3	No	No	2.7	No	No			Fair	Some ponding and vegetation	Curb ramp facing the wrong way	0
49	Medford	No	No	No	14.3	1	0.7	No	0	14.3		No			Poor	No flares		0
50	Medford	Yes	No	Yes	6.4	No	2.6	Yes	Yes	2.0	Yes	No			Fair	Heavy vegetation	Ponding	0
51	Medford	Yes	No	No	9.4	No	3.1	Yes	No	7.0	Yes	No			Fair	Some ponding and vegetation		0
52	Medford	Yes	No	Yes	2.4	1	0.2	Yes	Yes	1.2	Yes	No			Fair	Some vegetation		0
53	Medford	Yes	No	No	10.5	1	0.0	Yes	No	5.3	Yes	No			Poor	Ponding	Bad ponding	0
54	Medford	Yes	No	Yes	4.5	1	0.7	Yes	No	4.5		No			Good	No flares		0
151	Owatonna	Yes	No	Yes	0.8	1	0.6	Yes	Yes	0.8	Yes	Yes	Yes	Yes	Good		Bit of a gap in the curb ramp	1
152	Owatonna	Yes	No	Yes	2.5	No	3.8	Yes	Yes	1.1	Yes	Yes	Yes	Yes	Good			0
153	Owatonna	Yes	No	Yes	0.2	1	0.1	Yes	Yes	0.2	Yes	Yes	Yes	Yes	Poor	Ponding	Literally a sand pit	0
154	Owatonna	Yes	No	Yes	1.1	1	0.2	Yes	Yes	1.1	Yes	Yes	Yes	Yes	Good	Ponding		1
155	Owatonna	Yes	No	Yes	0.4	1	0.3	Yes	Yes	0.4	Yes	Yes	Yes	Yes	Fair	Ponding		1
156	Owatonna	Yes	No	Yes	1.5	1	1.0	Yes	Yes	1.5	Yes	Yes	Yes	Yes	Good	Ponding		1
157	Owatonna	Yes	No	Yes	3.2	1	0.4	Yes	Yes	0.9	Yes	Yes	Yes	Yes	Good			1
158	Owatonna	Yes	No	Yes	0.3	1	0.5	Yes	Yes	0.5	Yes	Yes	Yes	Yes	Good	Ponding		1
159	Owatonna	Yes	No	Yes	7.5	No	2.7	Yes	No	3.3	Yes	No			Fair	Some vegetation	Gap in elevation	0
160	Owatonna	Yes	No	Yes	5.1	1	1.3	Yes	Yes	1.0	Yes	No			Good	Some vegetation		0
161	Owatonna	Yes	No	Yes	3.3	1	0.4	Yes	Yes	0.4	Yes	No			Good			0
162	Owatonna	Yes	No	Yes	5.3	1	0.9	Yes	Yes	1.5	Yes	No			Fair	Ponding		0
163	Owatonna	Yes	No	Yes	3.9	No	2.9	Yes	Yes	0.7	Yes	No			Good	Ponding		0
164	Owatonna	Yes	No	Yes	4.5	1	0.5	Yes	Yes	0.9	Yes	Yes			Fair			1
165	Owatonna	Yes	Yes	Yes	1.5	1	1.1	Yes	Yes	1.5	Yes	N/A			Good	No flares needed	Only one flare	1
166	Owatonna	Yes	Yes	Yes	3.4	No	4.2	Yes	Yes	1.3	Yes	N/A			Good		Only one flare	0
167	Owatonna	Yes	Yes	Yes	0.8	No	3.1	Yes	Yes	1.7	Yes	N/A			Fair	Extensive cracking		0
168	Owatonna	Yes	Yes	Yes	4.5	No	3.8	Yes	Yes	1.2	Yes	N/A			Good			0
169	Owatonna	Yes	Yes	Yes	1.3	No	2.5	Yes	Yes	1.4	Yes	N/A			Good			0
170	Owatonna	Yes	Yes	Yes	2.0	No	2.5	Yes	Yes	2.0	Yes	N/A			Fair	Some cracking	Hole in sidewalk	0
171	Owatonna	Yes	Yes	Yes	2.7	No	5.0	Yes	No	2.6	Yes	N/A			Good			0
172	Owatonna	Yes	Yes	Yes	1.8	No	4.0	Yes	Yes	1.8	Yes	N/A			Good			0
173	Owatonna	Yes	Yes	Yes	1.3	No	5.3	Yes	No	2.4		N/A			Good	No flares needed		0
174	Owatonna	Yes	Yes	Yes	1.2	No	5.1	Yes	No	2.2		N/A			Good	No flares needed		0
175	Owatonna	Yes	Yes	Yes	0.5	No	5.1	Yes	Yes	1.9		N/A			Good	No flares needed		0
176	Owatonna	Yes	Yes	Yes	2.2	No	4.7	Yes	Yes	2.0		N/A			Good	No flares needed		0
177	Owatonna	Yes	No	Yes	3.9	1	0.5	Yes	Yes	2.0	Yes	No			Fair	Some ponding and vegetation		0
178	Owatonna	Yes	No	Yes	5.0	No	2.3	Yes	Yes	1.6	Yes	No			Fair	Some ponding and vegetation		0
179	Owatonna	Yes	No	Yes	4.4	1	0.4	Yes	Yes	1.7	Yes	No			Good			0
180	Owatonna	Yes	Yes	Yes	0.5	No	3.8	Yes	Yes	1.2		N/A			Good	No flares needed		0
181	Owatonna	Yes	Yes	Yes	2.1	No	5.2	Yes	Yes	1.7		N/A			Poor	No flares needed and ponding		0
182	Owatonna	Yes	Yes	Yes	3.6	No	4.8	Yes	Yes	0.8		N/A			Good	No flares needed		0
183	Owatonna	Yes	Yes	Yes	1.8	No	4.7	Yes	Yes	0.8		N/A			Good	No flares needed		0
184	Owatonna	Yes	Yes	Yes	2.6	No	5.6	Yes	Yes	1.9		N/A			Good	No flares needed		0
185	Owatonna	Yes	Yes	Yes	1.8	No	4.6	Yes	Yes	1.6		N/A			Good	No flares needed and ponding		0
186	Owatonna	Yes	Yes	Yes	2.6	No	4.2	Yes	Yes	1.7		N/A			Good	No flares needed		0
187	Owatonna	Yes	Yes	Yes	2.2	No	4.5	Yes	No	2.6		N/A			Good	No flares needed		0
188	Owatonna	Yes	Yes	Yes	1.7	No	3.0	Yes	Yes	1.3		N/A			Good	No flares needed		0
189	Owatonna	Yes	Yes	Yes	2.0	No	5.0	Yes	Yes	0.8		N/A			Good	No flares needed		0
190	Owatonna	Yes	No	Yes	8.2	1	0.5	Yes	Yes	1.6	Yes	No			Good			0
191	Owatonna	Yes	No	Yes	7.8	1	0.6	Yes	Yes	0.5	Yes	No			Fair	Ponding		0
192	Owatonna	Yes	No	Yes	4.8	1	0.3	Yes	Yes	1.7	Yes	No			Good	Some vegetation		0
193	Owatonna	Yes	No	Yes	6.3	1	1.0	Yes	No	2.2	Yes	No			Good	Some vegetation		0
194	Owatonna	Yes	Yes	Yes	2.9	No	4.8	Yes	Yes	1.7		N/A			Good	No flares needed and ponding		0
195	Owatonna	Yes	Yes	Yes	4.1	No	5.4	Yes	No	2.2		N/A			Good	No flares needed		0
196	Owatonna	Yes	Yes	Yes	2.9	No	5.3	Yes	No	3.6		N/A			Good	No flares needed		0
197	Owatonna	Yes	Yes	Yes	2.9	No	4.3	Yes	No	2.9		N/A			Good	No flares needed		0
198	Owatonna	Yes	Yes	Yes	2.5	No	5.2	Yes	No	2.7		N/A			Fair	No flares needed		0
199	Owatonna	Yes	Yes	Yes	1.7	No	6.3	Yes	No	3.2		N/A			Good	No flares needed		0
200	Owatonna	Yes	Yes	Yes	3.5	No	6.1	Yes	No	2.4		N/A			Good	No flares needed		0
201	Owatonna	Yes	Yes	Yes	1.6	No	5.8	Yes	No	3.3		N/A			Good	No flares needed		0
202	Owatonna	Yes	Yes	Yes	3.0	No	4.4	Yes	Yes	1.8		N/A			Good	No flares needed		0
203	Owatonna	Yes	Yes	Yes	2.1	No	5.4	Yes	Yes	1.4		N/A			Good	No flares needed		0
204	Owatonna	Yes	Yes	Yes	2.8	No	5.3	Yes	Yes	1.4		N/A			Good	No flares needed		0
205	Owatonna	Yes	Yes	Yes	0.5	No	5.6	No	No	3.9		N/A			Fair	No flares needed and ponding		0
206	Owatonna	Yes	Yes	Yes	1.2	No	5.3	Yes	No	3.9		N/A			Good	No flares needed		0

OBJECTID	City	If walk/trail crosses curb, is there a curb ramp?	Is the Curb Ramp at a Driveway	Running slope <= 8.3%?	What is the running slope of the curb ramp?	Cross slope, excluding flares, <= 2%?	What is the cross slope of the curb ramp?	Curb ramp, excluding flares, at least 48in wide?	Landing >= 48in sq with cross slope <2% any dir?	What is the max landing slope?	Curb ramp flares slopes <= 10%?	Detectable warnings full width of the curb ramp?	Approx 75% of truncated domes in good condition?	Truncated domes contrast w/ adjacent surfaces?	Curb Ramp overall condition?	CR Characteristics	Notes	Compliant 1=Compliant
207	Owatonna	Yes	Yes	Yes	1.3	No	5.0	Yes	No	2.6		N/A			Fair	No flares needed and ponding		0
208	Owatonna	Yes	Yes	Yes	2.5	No	2.9	Yes	Yes	1.3		N/A			Good	No flares needed		0
209	Owatonna	Yes	Yes	Yes	1.7	No	3.0	Yes	Yes	1.6		N/A			Good	No flares needed and ponding		0
210	Owatonna	Yes	Yes	Yes	4.0	No	4.3	Yes	Yes	2.0		N/A			Fair	No flares needed	Cracking	0
211	Owatonna	Yes	Yes	Yes	3.1	No	4.6	Yes	Yes	2.0		Yes			Fair	No flares needed	Cracking	0
212	Owatonna	Yes	Yes	Yes	2.9	No	5.4	Yes	Yes	1.9		N/A			Good	No flares needed		0
213	Owatonna	Yes	Yes	Yes	2.4	No	3.6	Yes	No	2.5		N/A			Good	No flares needed		0
214	Owatonna	Yes	Yes	Yes	3.0	No	3.8	Yes	Yes	1.8		N/A			Good	No flares needed		0
215	Owatonna	Yes	Yes	Yes	1.3	No	3.4	Yes	No	2.6		N/A			Good	No flares needed		0
216	Owatonna	Yes	Yes	Yes	2.8	No	3.9	Yes	Yes	1.8		N/A			Good	No flares needed		0
217	Owatonna	Yes	Yes	Yes	2.3	No	4.4	Yes	No	2.3		N/A			Good	No flares needed		0
218	Owatonna	Yes	Yes	Yes	2.2	No	5.2	Yes	Yes	1.9		N/A			Good	No flares needed		0
219	Owatonna	Yes	Yes	Yes	1.4	No	5.2	Yes	No	2.9		N/A			Good	No flares needed		0
220	Owatonna	Yes	Yes	Yes	3.8	No	4.8	Yes	Yes	1.7		N/A			Good	No flares needed		0
221	Owatonna	Yes	Yes	Yes	1.0	No	3.0	Yes	No	3.4	Yes	N/A			Good		Only one flare	0
222	Owatonna	Yes	Yes	Yes	3.6	No	3.1	Yes	Yes	1.0		N/A			Good	Some cracking	Only one flare	0
223	Owatonna	Yes	Yes	Yes	1.7	No	2.4	Yes	Yes	1.0		N/A			Good		Only one flare	0
224	Owatonna	Yes	Yes	Yes	4.0	No	2.3	Yes	Yes	0.4	No	N/A			Good	Some cracking	Only one flare	0
225	Owatonna	Yes	Yes	Yes	3.0	No	2.7	Yes	Yes	0.3	No	N/A			Good		Only one flare	0
328	Owatonna	Yes	No	Yes	3.9	1	0.0	Yes	Yes	1.8	Yes	No			Good			0
329	Owatonna	Yes	Yes	Yes	6.8	No	2.6	Yes	Yes	0.9	Yes	N/A			Fair	Some vegetation		0
331	Owatonna	Yes	Yes	Yes	2.9	No	2.6	Yes	Yes	1.4		N/A			Good	No flares needed		0
332	Owatonna	Yes	Yes	Yes	4.6	1	2.0	Yes	Yes	1.8		N/A			Good	No flares needed		1
333	Owatonna	Yes	Yes	Yes	1.4	No	3.9	Yes	Yes	1.8		N/A			Good	No flares needed		0
334	Owatonna	Yes	Yes	Yes	1.7	No	4.0	No	No	3.0		N/A			Good	No flares needed		0
335	Owatonna	Yes	No	Yes	1.5	No	2.5	Yes	No	2.5		No			Fair	No flares	Crack	0
382	Owatonna	Yes	No	Yes	4.9	No	3.4	Yes	Yes	0.9	Yes	No			Good	Some cracking and vegetation		0
383	Owatonna	Yes	No	Yes	4.8	No	3.2	Yes	Yes	1.0	Yes	No			Good	Some cracking and vegetation		0
391	Owatonna	Yes	No	Yes	3.5	1	1.1	Yes	Yes	1.6	Yes	No			Fair	Some cracking	Manhole	0
392	Owatonna	Yes	No	Yes	4.0	1	1.3	Yes	Yes	1.6	Yes	No			Fair	Ponding		0
393	Owatonna	Yes	No	Yes	7.2	1	0.8	Yes	Yes	1.2	Yes	Yes	No	Yes	Good	Ponding		0
394	Owatonna	Yes	No	Yes	4.6	1	1.1	Yes	Yes	1.2	Yes	Yes	Yes	Yes	Fair	Ponding		1
395	Owatonna	Yes	No	Yes	4.0	1	0.9	Yes	Yes	1.5	Yes	Yes	Yes	Yes	Good	Ponding		1
396	Owatonna	Yes	No	Yes	6.9	1	1.4	Yes	Yes	1.5	Yes	Yes	Yes	Yes	Fair	Some ponding and vegetation		1
397	Owatonna	Yes	No	Yes	7.9	1	0.7	Yes	Yes	0.7	Yes	Yes	Yes	Yes	Fair		Gap in elevation	1
398	Owatonna	Yes	No	Yes	6.4	1	1.6	Yes	Yes	0.7	Yes	Yes	Yes	Yes	Good			1
399	Owatonna	Yes	No	Yes	3.3	1	0.4	Yes	Yes	1.4	Yes	No			Good			0
400	Owatonna	Yes	No	Yes	4.3	1	0.6	Yes	Yes	0.5	Yes	Yes	Yes	Yes	Good			1
401	Owatonna	Yes	No	Yes	3.0	1	0.7	Yes	Yes	0.6	Yes	Yes	Yes	Yes	Good			1
402	Owatonna	Yes	No	Yes	3.7	1	0.8	Yes	Yes	0.4	Yes	Yes	Yes	Yes	Good			1
403	Owatonna	Yes	No	Yes	6.5	1	0.9	Yes	Yes	1.4	Yes	Yes	Yes	Yes	Good			1
404	Owatonna	Yes	No	Yes	8.2	1	0.9	Yes	Yes	1.4	Yes	Yes	Yes	Yes	Fair		Gap in elevation	1
420	Owatonna	Yes	Yes	Yes	1.0	No	5.0	Yes	No	4.2		N/A			Good	No flares needed		0
421	Owatonna	Yes	Yes	Yes	0.6	No	5.5	Yes	No	3.5		N/A			Good	No flares needed		0
422	Owatonna	Yes	Yes	Yes	1.1	No	2.4	Yes	No	2.4		N/A			Good	No flares needed		0
423	Owatonna	Yes	No	Yes	2.3	1	1.4	Yes	No	2.3	Yes	Yes	Yes	Yes	Fair	Ponding		0
424	Owatonna	Yes	No	Yes	5.3	No	3.8	Yes	No	3.5	Yes	Yes	Yes	Yes	Good			0
425	Owatonna	Yes	No	Yes	4.2	1	0.5	Yes	Yes	0.8	Yes	Yes	Yes	Yes	Good			1
426	Owatonna	Yes	No	Yes	4.3	1	1.3	Yes	Yes	1.1	Yes	Yes	Yes	Yes	Good			1
427	Owatonna	Yes	No	Yes	2.0	No	5.6	Yes	Yes	1.9	Yes	Yes	Yes	Yes	Good			0
428	Owatonna	Yes	No	Yes	1.7	No	5.2	Yes	Yes	1.9	Yes	Yes	Yes	Yes	Good		Some cracking in warnings	0
429	Owatonna	Yes	No	Yes	5.7	No	3.4	Yes	No	2.4	Yes	Yes	Yes	Yes	Good			0
430	Owatonna	Yes	No	Yes	3.8	No	3.2	Yes	No	3.4	No	No			Fair		One flare, weird curb ramp	0
431	Owatonna	Yes	No	Yes	0.1	No	3.1	Yes	Yes	1.6	Yes	Yes	Yes	Yes	Good	Ponding		0
432	Owatonna	Yes	No	Yes	2.0	No	2.7	Yes	Yes	0.8	Yes	Yes	Yes	Yes	Good			0
433	Owatonna	Yes	Yes	Yes	2.6	No	3.3	Yes	Yes	1.9		N/A			Fair	No flares needed	Gap in elevation	0
434	Owatonna	Yes	Yes	Yes	1.6	No	3.6	Yes	Yes	1.7		N/A			Good	No flares needed		0
435	Owatonna	Yes	No	Yes	3.5	1	0.4	Yes	Yes	0.9	Yes	Yes	Yes	Yes	Fair	Ponding		1
437	Owatonna	Yes	No	Yes	5.8	1	0.5	Yes	Yes	0.5	Yes	Yes	Yes	Yes	Fair	Ponding		1
438	Owatonna	Yes	No	Yes	3.5	1	1.8	Yes	Yes	0.7	Yes	Yes	Yes	Yes	Fair	Ponding		1
439	Owatonna	Yes	Yes	Yes	1.0	No	2.7	Yes	Yes	1.5		N/A			Good	No flares needed		0
440	Owatonna	Yes	Yes	Yes	1.8	No	4.0	Yes	Yes	0.6		N/A			Fair	No flares needed	Ponding	0
441	Owatonna	Yes	No	Yes	3.6	1	0.7	Yes	Yes	1.7	Yes	No			Fair	Ponding	One flare	0
442	Owatonna	Yes	No	Yes	1.6	1	0.6	Yes	Yes	1.9	Yes	No			Fair	Ponding	One flare	0
443	Owatonna	Yes	No	Yes	3.0	1	0.8	Yes	Yes	1.9	No	Yes	Yes	Yes	Fair	Ponding		0
444	Owatonna	Yes	No	Yes	2.0	1	1.2	Yes	Yes	2.0		No			Good		One flare	0
445	Owatonna	Yes	No	Yes	5.9	No	2.8	Yes	No	2.6	No	Yes	Yes	Yes	Good			0
446	Owatonna	Yes	No	Yes	3.9	No	3.9	Yes	Yes	1.1	No	Yes	Yes	Yes	Fair	Ponding		0
447	Owatonna	Yes	No	Yes	7.7	1	1.0	Yes	Yes	0.5	Yes	No			Fair	Ponding		0
448	Owatonna	Yes	No	Yes	7.9	1	0.1	Yes	Yes	0.4	Yes	No			Poor	Ponding	Crack	0
449	Owatonna	Yes	No	Yes	5.2	1	1.0	Yes	Yes	1.0	Yes	No			Good			0
455	Owatonna	Yes	No	Yes	3.8	1	0.8	Yes	Yes	0.8	Yes	No			Fair	Ponding		0
456	Owatonna	Yes	No	Yes	5.3	1	0.4	Yes	Yes	1.3	No	No			Fair	Ponding		0
457	Owatonna	Yes	No	Yes	5.8	1	0.6	Yes	Yes	1.3	Yes	No			Poor	Heavy vegetation		0
465	Owatonna	Yes	Yes	Yes	1.2	No	3.4	Yes	Yes	1.8		N/A			Good	No flares needed		0
466	Owatonna	Yes	Yes	Yes	0.5	No	5.0	Yes	No	2.5		N/A			Good	No flares needed		0
467	Owatonna	Yes	No	No	10.1	1	1.3	Yes	Yes	1.4	Yes	Yes	Yes	Yes	Fair	Ponding		0
468	Owatonna	Yes	Yes	Yes	1.5	No	3.3	Yes	Yes	1.9		N/A			Good	No flares needed		0
469	Owatonna	Yes	Yes	Yes	0.6	No	3.5	Yes	Yes	0.7		N/A			Good	No flares needed		0
478	Owatonna	Yes	No	Yes	5.9	1	1.8	Yes	Yes	1.1	Yes	No			Fair	Some vegetation		0
479	Owatonna	Yes	No	No	8.4	No	2.1	Yes	No	2.6	Yes	No			Good			0

OBJECTID	City	If walk/trail crosses curb, is there a curb ramp?	Is the Curb Ramp at a Driveway	Running slope <= 8.3%?	What is the running slope of the curb ramp?	Cross slope, excluding flares, <= 2%?	What is the cross slope of the curb ramp?	Curb ramp, excluding flares, at least 48in wide?	Landing >= 48in sq with cross slope <2% any dir?	What is the max landing slope?	Curb ramp flares slopes <= 10%?	Detectable warnings full width of the curb ramp?	Approx 75% of truncated domes in good condition?	Truncated domes contrast w/ adjacent surfaces?	Curb Ramp overall condition?	CR Characteristics	Notes	Compliant 1=Compliant
480	Owatonna	Yes	No	Yes	2.7	No	3.9	Yes	Yes	2.0	Yes	No			Fair	Some vegetation		0
489	Owatonna	Yes	Yes	Yes	0.3	No	4.4	Yes	Yes	1.7	Yes	N/A			Good	No flares needed	One flare	0
490	Owatonna	Yes	No	Yes	4.2	1	1.3	Yes	Yes	1.7	Yes	No	Yes	Yes	Good		One flare, along driveway	0
491	Owatonna	Yes	Yes	Yes	2.2	No	3.9	Yes	Yes	1.7		N/A			Good	No flares needed		0
492	Owatonna	Yes	No	Yes	1.6	No	3.3	Yes	Yes	1.7	Yes	No	Yes	Yes	Good		Broken flare	0
493	Owatonna	Yes	No	Yes	2.2	No	3.7	Yes	Yes	1.9	Yes	Yes	Yes	Yes	Good			0
494	Owatonna	Yes	Yes	Yes	5.1	No	3.0	Yes	Yes	1.2		N/A			Good	No flares needed	Some veg	0
495	Owatonna	Yes	Yes	Yes	4.5	No	4.3	Yes	Yes	1.7		N/A			Good	No flares needed		0
496	Owatonna	Yes	Yes	Yes	2.8	No	2.4	Yes	Yes	1.1		N/A			Good	No flares needed		0
497	Owatonna	Yes	Yes	Yes	1.8	1	1.4	Yes	Yes	1.8		N/A			Good	No flares needed		1
498	Owatonna	Yes	No	Yes	5.5	1	2.0	Yes	Yes	0.8	Yes	No			Good			0
499	Owatonna	Yes	No	Yes	4.7	1	0.4	Yes	Yes	0.4	Yes	No			Good			0
500	Owatonna	Yes	Yes	Yes	5.0	No	4.1	Yes	Yes	1.0		N/A			Good	No flares needed		0
501	Owatonna	Yes	Yes	Yes	5.5	No	4.5	Yes	Yes	1.0		N/A			Good	No flares needed		0
502	Owatonna	Yes	Yes	Yes	4.5	No	5.1	Yes	Yes	1.2		N/A			Good	No flares needed	Some veg	0
503	Owatonna	Yes	Yes	Yes	4.2	No	5.5	Yes	Yes	1.4		N/A			Good	No flares needed	Some veg	0
504	Owatonna	Yes	Yes	Yes	4.6	No	4.7	Yes	Yes	1.6		N/A			Good	No flares needed		0
505	Owatonna	Yes	Yes	Yes	3.6	No	4.5	Yes	Yes	1.2		N/A			Fair	No flares needed	Some ponding	0
506	Owatonna	Yes	Yes	Yes	5.7	No	4.6	Yes	Yes	0.7		N/A			Good	No flares needed		0
507	Owatonna	Yes	Yes	Yes	5.5	No	5.8	Yes	Yes	1.9		N/A			Good	No flares needed		0
508	Owatonna	Yes	Yes	Yes	6.7	No	4.1	Yes	Yes	1.9		N/A			Good	No flares needed		0
509	Owatonna	Yes	Yes	Yes	4.9	No	4.9	Yes	Yes	1.2		N/A			Good	No flares needed	Some veg	0
510	Owatonna	Yes	Yes	Yes	4.9	No	4.3	Yes	Yes	1.5		N/A			Fair	No flares needed	Vegetation	0
511	Owatonna	Yes	Yes	Yes	5.7	No	5.5	Yes	Yes	1.3		N/A			Good	No flares needed		0
512	Owatonna	Yes	Yes	Yes	3.6	No	6.1	Yes	Yes	2.0		N/A			Good	No flares needed		0
513	Owatonna	Yes	Yes	Yes	7.2	No	6.3	Yes	Yes	2.0		N/A			Good	No flares needed		0
514	Owatonna	Yes	Yes	Yes	5.4	No	4.4	Yes	Yes	1.7		N/A			Good	No flares needed		0
515	Owatonna	Yes	Yes	No	10.4	No	8.3	Yes	Yes	2.0		N/A			Good	No flares needed		0
516	Owatonna	Yes	No	Yes	1.3	1	0.8	Yes	Yes	1.3	Yes	Yes	Yes	Yes	Good			1
517	Owatonna	Yes	No	Yes	2.6	1	0.3	Yes	Yes	0.9	Yes	Yes	Yes	Yes	Good			1
518	Owatonna	Yes	Yes	Yes	4.8	No	4.2	Yes	Yes	1.0		N/A			Good	No flares needed		0
519	Owatonna	Yes	Yes	Yes	5.8	No	2.7	Yes	Yes	1.4		N/A			Good	No flares needed		0
520	Owatonna	Yes	Yes	Yes	4.5	No	4.7	Yes	Yes	1.4		N/A			Good	No flares needed		0
521	Owatonna	Yes	Yes	Yes	5.5	No	5.7	Yes	Yes	2.0		N/A			Good	No flares needed		0
522	Owatonna	Yes	Yes	Yes	4.0	No	3.6	Yes	Yes	2.0		N/A			Good	No flares needed		0
523	Owatonna	Yes	Yes	Yes	6.0	No	5.8	Yes	No	2.3		N/A			Good	No flares needed		0
524	Owatonna	Yes	Yes	Yes	5.1	No	5.9	Yes	No	2.8		N/A			Good	No flares needed		0
525	Owatonna	Yes	Yes	Yes	4.7	No	6.5	Yes	No	2.7		N/A			Good	No flares needed		0
526	Owatonna	Yes	Yes	Yes	6.1	No	5.0	Yes	No	2.4		N/A			Good	No flares needed		0
527	Owatonna	Yes	Yes	Yes	5.6	No	5.9	Yes	Yes	1.2		N/A			Good	No flares needed		0
528	Owatonna	Yes	Yes	Yes	3.8	No	4.5	Yes	Yes	1.4		N/A			Good	No flares needed		0
529	Owatonna	Yes	Yes	Yes	4.2	No	5.0	Yes	Yes	2.0		N/A			Good	No flares needed		0
530	Owatonna	Yes	Yes	Yes	6.1	No	4.1	Yes	Yes	1.9		N/A			Good	No flares needed		0
531	Owatonna	Yes	Yes	Yes	4.0	No	3.2	Yes	Yes	1.2		N/A			Good	No flares needed		0
532	Owatonna	Yes	Yes	Yes	4.6	No	3.3	Yes	Yes	1.7		N/A			Fair	No flares needed	Ponding	0
533	Owatonna	Yes	Yes	Yes	2.9	No	4.5	Yes	Yes	1.5		N/A			Good	No flares needed		0
534	Owatonna	Yes	Yes	Yes	6.0	No	3.2	Yes	Yes	1.6		N/A			Good	No flares needed	Some veg	0
535	Owatonna	Yes	Yes	Yes	3.5	No	4.2	Yes	Yes	1.0		N/A			Good	No flares needed		0
536	Owatonna	Yes	Yes	Yes	7.3	No	5.0	Yes	Yes	1.6		N/A			Good	No flares needed		0
537	Owatonna	Yes	Yes	Yes	6.2	No	5.3	Yes	Yes	1.5		N/A			Good	No flares needed		0
538	Owatonna	Yes	Yes	Yes	6.2	No	2.2	Yes	Yes	1.5		N/A			Good	No flares needed		0
539	Owatonna	Yes	Yes	Yes	3.7	No	6.3	Yes	Yes	1.3		N/A			Good	No flares needed		0
540	Owatonna	Yes	No	Yes	1.7	1	1.4	Yes	Yes	1.7	Yes	Yes	Yes	Yes	Good			1
541	Owatonna	Yes	No	Yes	1.8	1	0.7	Yes	Yes	1.8	Yes	Yes	Yes	Yes	Good			1
542	Owatonna	Yes	Yes	Yes	5.4	No	4.4	Yes	Yes	1.0		N/A			Good	No flares needed		0
543	Owatonna	Yes	Yes	Yes	3.1	No	4.8	Yes	Yes	1.9		N/A			Good	No flares needed		0
544	Owatonna	Yes	Yes	Yes	6.5	No	4.4	Yes	Yes	1.6		N/A			Good	No flares needed		0
545	Owatonna	Yes	Yes	Yes	3.9	No	5.5	Yes	Yes	1.3		N/A			Good	No flares needed		0
546	Owatonna	Yes	Yes	Yes	8.0	No	4.4	Yes	Yes	1.5		N/A			Fair	No flares needed	Veg	0
547	Owatonna	Yes	Yes	Yes	4.0	No	4.5	Yes	Yes	0.9		N/A			Good	No flares needed		0
548	Owatonna	Yes	Yes	Yes	6.2	No	2.8	Yes	Yes	0.4		N/A			Good	No flares needed		0
549	Owatonna	Yes	Yes	Yes	5.2	No	5.6	Yes	Yes	0.4		N/A			Good	No flares needed		0
550	Owatonna	Yes	Yes	Yes	5.3	No	3.8	Yes	Yes	0.6		N/A			Good	No flares needed		0
551	Owatonna	Yes	Yes	Yes	5.6	No	5.6	Yes	Yes	0.5		N/A			Good	No flares needed		0
552	Owatonna	Yes	Yes	Yes	7.5	No	2.3	Yes	Yes	1.0		N/A			Good	No flares needed		0
553	Owatonna	Yes	Yes	Yes	3.6	No	4.4	Yes	Yes	0.7		N/A			Good	No flares needed		0
554	Owatonna	Yes	Yes	Yes	5.9	No	3.3	Yes	Yes	1.2		N/A			Good	No flares needed		0
555	Owatonna	Yes	Yes	Yes	4.5	No	3.3	Yes	Yes	1.1		N/A			Good	No flares needed		0
556	Owatonna	Yes	Yes	Yes	2.3	No	3.3	Yes	Yes	1.0		N/A			Good	No flares needed		0
557	Owatonna	Yes	Yes	Yes	6.1	No	6.0	Yes	Yes	1.2		N/A			Fair	No flares needed	Some veg	0
558	Owatonna	Yes	Yes	Yes	6.7	1	1.6	Yes	Yes	1.7		N/A			Good	No flares needed		1
559	Owatonna	Yes	Yes	Yes	5.4	No	4.0	Yes	Yes	1.0		N/A			Fair	No flares needed	Ponding	0
560	Owatonna	Yes	Yes	Yes	5.0	No	3.4	Yes	Yes	1.1		N/A			Good	No flares needed		0
561	Owatonna	Yes	Yes	Yes	3.9	No	4.0	Yes	Yes	0.5		N/A			Good	No flares needed		0
562	Owatonna	Yes	No	Yes	5.6	No	4.3	Yes	Yes	1.8	Yes	No			Good			0
563	Owatonna	Yes	No	Yes	6.4	No	3.6	Yes	Yes	1.4	Yes	No			Good			0
564	Owatonna	Yes	Yes	Yes	5.4	0	1.1	Yes	Yes	0.3		N/A			Good	No flares needed		1
565	Owatonna	Yes	Yes	Yes	4.6	No	2.1	Yes	Yes	0.6		N/A			Good	No flares needed		0
566	Owatonna	Yes	Yes	Yes	5.5	No	3.0	Yes	Yes	0.7		N/A			Good	No flares needed		0
567	Owatonna	Yes	Yes	Yes	3.7	No	4.2	Yes	Yes	1.6		N/A			Good	No flares needed		0
568	Owatonna	Yes	Yes	Yes	5.7	No	3.5	Yes	Yes	1.6		N/A			Good	No flares needed		0

OBJECTID	City	If walk/trail crosses curb, is there a curb ramp?	Is the Curb Ramp at a Driveway	Running slope <= 8.3%?	What is the running slope of the curb ramp?	Cross slope, excluding flares, <= 2%?	What is the cross slope of the curb ramp?	Curb ramp, excluding flares, at least 48in wide?	Landing >= 48in sq with cross slope <2% any dir?	What is the max landing slope?	Curb ramp flares slopes <= 10%?	Detectable warnings full width of the curb ramp?	Approx 75% of truncated domes in good condition?	Truncated domes contrast w/ adjacent surfaces?	Curb Ramp overall condition?	CR_Characteristics	Notes	Compliant 1=Compliant
569	Owatonna	Yes	Yes	Yes	5.1	No	3.9	Yes	Yes	1.2		N/A			Fair	No flares needed	Veg	0
570	Owatonna	Yes	No	Yes	4.7	1	2.0	Yes	Yes	0.8	Yes	No			Good			0
571	Owatonna	Yes	No	Yes	4.7	1	0.5	Yes	Yes	0.9	Yes	No			Fair	Some vegetation		0
572	Owatonna	Yes	Yes	Yes	6.1	No	3.4	Yes	Yes	1.2		N/A			Good	No flares needed		0
573	Owatonna	Yes	Yes	Yes	3.3	No	2.7	Yes	Yes	0.9		N/A			Good	No flares needed		0
574	Owatonna	Yes	Yes	Yes	4.8	No	4.4	Yes	Yes	1.5		N/A			Good	No flares needed		0
575	Owatonna	Yes	Yes	Yes	3.9	1	2.0	Yes	Yes	1.1		N/A			Good	No flares needed		1
576	Owatonna	Yes	No	Yes	5.0	1	1.7	Yes	Yes	1.6	Yes	No			Fair	Ponding		0
577	Owatonna	Yes	Yes	Yes	6.6	No	2.1	Yes	Yes	1.6	Yes	N/A			Fair	Ponding		0
626	Owatonna	Yes	No	Yes	6.1	1	2.0	Yes	Yes	1.5	Yes	No			Good	Some cracking		0
627	Owatonna	Yes	No	Yes	5.4	1	1.9	Yes	Yes	1.7	Yes	No			Fair	Some cracking	Gap in elevation and only one flare	0
628	Owatonna	Yes	No	Yes	6.9	1	0.9	Yes	Yes	0.8	Yes	No			Fair	Some cracking		0
629	Owatonna	Yes	No	Yes	3.5	1	1.2	Yes	Yes	1.9	Yes	No			Fair	Ponding	Gap in elevation	0
630	Owatonna	Yes	No	Yes	3.2	No	5.5	Yes	Yes	1.9	Yes	No			Fair		Flares broken	0
631	Owatonna	Yes	No	Yes	3.5	1	1.0	Yes	Yes	0.5	Yes	Yes	No	Yes	Good		Man hole	0
632	Owatonna	Yes	No	Yes	5.9	1	1.9	Yes	No	4.2	Yes	Yes	No	Yes	Good	Some cracking		0
633	Owatonna	Yes	No	Yes	4.9	1	1.0	Yes	Yes	1.8	Yes	No			Good		Broken flare	0
634	Owatonna	Yes	No	Yes	5.7	1	0.3	Yes	Yes	1.5	Yes	No			Good	Ponding	Crack and gap	0
635	Owatonna	Yes	No	Yes	4.2	No	3.0	Yes	No	2.3	Yes	No			Good			0
636	Owatonna	Yes	No	Yes	1.8	1	1.8	Yes	Yes	1.8	Yes	No			Good			0
637	Owatonna	Yes	Yes	Yes	5.3	No	3.0	Yes	Yes	2.0	Yes	N/A			Good			0
638	Owatonna	Yes	Yes	Yes	0.9	No	3.5	Yes	No	3.5		N/A			Good	No flares needed		0
639	Owatonna	Yes	Yes	Yes	6.0	No	3.9	Yes	No	3.8		N/A			Good	No flares needed		0
640	Owatonna	Yes	Yes	Yes	1.5	No	5.4	Yes	No	3.1		N/A			Good	No flares needed		0
641	Owatonna	Yes	Yes	Yes	6.9	No	4.7	Yes	No	3.6		N/A			Good	No flares needed		0
642	Owatonna	Yes	Yes	Yes	1.1	No	6.1	Yes	No	3.4		N/A			Good	No flares needed		0
643	Owatonna	Yes	Yes	Yes	6.6	No	5.2	Yes	No	3.5		N/A			Good	No flares needed		0
644	Owatonna	Yes	Yes	Yes	1.8	No	5.7	Yes	No	3.3		N/A			Good	No flares needed		0
645	Owatonna	Yes	Yes	Yes	8.1	No	4.6	Yes	No	2.9		N/A			Good	No flares needed		0
646	Owatonna	Yes	No	Yes	0.8	No	3.6	Yes	Yes	1.2	Yes	No			Good			0
647	Owatonna	Yes	No	No	10.5	No	6.7	Yes	No	2.8	Yes	No			Good			0
648	Owatonna	Yes	Yes	Yes	1.9	No	5.6	Yes	Yes	2.0		N/A			Fair	No flares needed	Gap in elevation , dirt	0
649	Owatonna	Yes	Yes	Yes	3.6	No	3.3	Yes	Yes	1.2		N/A			Good	No flares needed		0
650	Owatonna	Yes	Yes	Yes	2.1	No	5.7	Yes	Yes	1.7		N/A			Good	No flares needed		0
651	Owatonna	Yes	Yes	Yes	3.8	No	4.8	Yes	Yes	1.5		N/A			Good	No flares needed		0
652	Owatonna	Yes	Yes	Yes	2.1	No	4.8	Yes	Yes	2.0		N/A			Good	No flares needed		0
653	Owatonna	Yes	Yes	Yes	4.1	No	5.7	Yes	No	2.3		N/A			Good	No flares needed		0
654	Owatonna	Yes	Yes	Yes	4.3	No	5.1	Yes	Yes	1.5		N/A			Good	No flares needed		0
655	Owatonna	Yes	Yes	Yes	4.2	No	4.8	Yes	Yes	2.0		N/A			Good	No flares needed		0
656	Owatonna	Yes	Yes	Yes	3.3	No	6.1	Yes	No	2.5		N/A			Good	No flares needed		0
657	Owatonna	Yes	Yes	Yes	3.2	No	4.1	Yes	Yes	1.9		N/A			Good	No flares needed		0
658	Owatonna	Yes	Yes	Yes	4.4	No	2.8	Yes	Yes	1.9		N/A			Fair	No flares needed	Rocks	0
659	Owatonna	Yes	Yes	Yes	3.1	No	4.3	Yes	Yes	2		N/A			Fair	No flares needed	Rocks	0
660	Owatonna	Yes	Yes	Yes	4.9	No	3.4	Yes	No	3.2		N/A			Good	No flares needed		0
661	Owatonna	Yes	Yes	Yes	2.3	No	6.0	Yes	No	2.9		N/A			Good	No flares needed		0
662	Owatonna	Yes	Yes	Yes	5.4	No	5.6	Yes	No	2.9		N/A			Good	No flares needed		0
663	Owatonna	Yes	Yes	Yes	1.6	No	5.1	Yes	No	2.3		N/A			Good	No flares needed		0
664	Owatonna	Yes	Yes	Yes	6.3	No	4.9	Yes	No	2.8		N/A			Good	No flares needed		0
665	Owatonna	Yes	Yes	Yes	1.3	No	6.3	Yes	No	3.4		N/A			Good	No flares needed		0
666	Owatonna	Yes	Yes	Yes	7.0	No	5.1	Yes	No	3.2		N/A			Good	No flares needed		0
667	Owatonna	Yes	Yes	Yes	1.0	No	5.3	Yes	No	3.8		N/A			Good	No flares needed		0
668	Owatonna	Yes	Yes	Yes	7.4	No	5.2	Yes	No	3.0		N/A			Good	No flares needed		0
669	Owatonna	Yes	Yes	Yes	1.2	No	5.2	No	No	3.2		N/A			Good	No flares needed		0
670	Owatonna	Yes	Yes	Yes	8.1	No	5.8	Yes	No	3.7		N/A			Good	No flares needed		0
671	Owatonna	Yes	Yes	Yes	1.3	No	5.1	Yes	No	4.3		N/A			Good	No flares needed		0
672	Owatonna	Yes	No	No	9.0	No	4.0	Yes	No	3.8	Yes	No			Fair	Ponding	Flare broken	0
673	Owatonna	Yes	No	Yes	0.1	No	4.8	Yes	Yes	1.1	Yes	No			Good			0
674	Owatonna	Yes	Yes	Yes	8.1	No	2.5	Yes	No	3.3		N/A			Good	No flares needed	Crack	0
675	Owatonna	Yes	Yes	Yes	1.0	No	5.6	Yes	No	4.1		N/A			Good	No flares needed	Crack	0
676	Owatonna	Yes	No	Yes	5.4	No	2.3	Yes	Yes	2.0	Yes	No			Good			0
677	Owatonna	Yes	No	Yes	0.2	No	4.1	Yes	Yes	1.4	Yes	Yes	Yes	Yes	Good			0
678	Owatonna	Yes	Yes	Yes	1.4	No	5.1	Yes	No	2.7		N/A			Good	No flares needed		0
679	Owatonna	Yes	Yes	Yes	5.0	No	4.5	Yes	Yes	1.6		N/A			Good	No flares needed		0
680	Owatonna	Yes	Yes	Yes	4.8	1	0.9	Yes	Yes	1.9		N/A			Good	No flares needed		1
681	Owatonna	Yes	Yes	Yes	6.2	1	0.2	Yes	Yes	0.2		N/A			Good	No flares needed		1
682	Owatonna	Yes	Yes	Yes	3.1	No	3.9	Yes	Yes	1.1		N/A			Good	No flares needed		0
683	Owatonna	Yes	Yes	Yes	3.8	1	1.6	Yes	Yes	1.7		N/A			Good	No flares needed		1
684	Owatonna	Yes	No	Yes	5.0	1	0.3	Yes	Yes	1.8	Yes	No			Good			0
685	Owatonna	Yes	No	Yes	4.7	1	0.3	Yes	Yes	1.1	Yes	Yes	Yes	Yes	Fair	Ponding		1
686	Owatonna	Yes	No	Yes	4.0	1	2.0	Yes	Yes	0.9	Yes	No			Good			0
687	Owatonna	Yes	No	Yes	5.6	1	0.6	Yes	Yes	0.6	Yes	No			Good			0
688	Owatonna	Yes	No	Yes	3.9	1	1.4	Yes	Yes	0.8	Yes	No			Fair	Ponding		0
689	Owatonna	Yes	Yes	Yes	1.5	No	5.6	Yes	No	3.2		N/A			Good	No flares needed		0
690	Owatonna	Yes	Yes	Yes	3.7	1	1.6	No	No	3.7		N/A			Good	No flares needed		0
691	Owatonna	Yes	Yes	Yes	2.4	0	9.6	No	No	5.2		N/A			Fair	No flares needed	Some veg	0
692	Owatonna	Yes	No	Yes	5.6	1	1.7	Yes	No	3.5	Yes	No			Fair		One flare, attaches to driveway	0
693	Owatonna	Yes	No	Yes	2.1	No	2.2	Yes	Yes	1.9	Yes	No			Good			0
694	Owatonna	Yes	No	Yes	5.2	1	1.4	Yes	Yes	1.2	Yes	No			Good			0
695	Owatonna	Yes	No	No	8.8	No	2.5	Yes	Yes	1.9	Yes	No			Good		One flare and grate opening	0
696	Owatonna	Yes	No	Yes	7.6	1	1.8	Yes	Yes	2.0	Yes	No			Good			0
697	Owatonna	Yes	No	Yes	3.8	1	1.2	Yes	Yes	1.6	No	No			Good			0

OBJECTID	City	If walk/trail crosses curb, is there a curb ramp?	Is the Curb Ramp at a Driveway	Running slope <= 8.3%?	What is the running slope of the curb ramp?	Cross slope, excluding flares, <= 2%?	What is the cross slope of the curb ramp?	Curb ramp, excluding flares, at least 48in wide?	Landing >= 48in sq with cross slope <2% any dir?	What is the max landing slope?	Curb ramp flares slopes <= 10%?	Detectable warnings full width of the curb ramp?	Approx 75% of truncated domes in good condition?	Truncated domes contrast w/ adjacent surfaces?	Curb Ramp overall condition?	CR_Characteristics	Notes	Compliant 1=Compliant
710	Owatonna	Yes	No	Yes	0.0	1	0.7	Yes	Yes	0.7		Yes	Yes	Yes	Fair	No flares		1
711	Owatonna	Yes	No	Yes	0.8	1	0.1	Yes	Yes	0.8		Yes	Yes	Yes	Fair	No flares		1
712	Owatonna	Yes	No	Yes	1.3	1	0.8	Yes	Yes	1.3		Yes	Yes	Yes	Good	No flares		1
713	Owatonna	Yes	No	Yes	0.9	1	0.3	Yes	Yes	0.9		Yes	Yes	Yes	Fair	Ponding	Ponding or dirt	1
714	Owatonna	Yes	No	Yes	1.1	1	0.8	Yes	Yes	1.1		Yes	Yes	Yes	Fair	No flares	Ponding	1
715	Owatonna	Yes	No	Yes	0.8	1	0.9	Yes	Yes	0.9		Yes	Yes	Yes	Fair	No flares	Pounding	1
716	Owatonna	Yes	No	Yes	0.1	1	0.2	Yes	Yes	0.2		Yes	Yes	Yes	Fair	No flares	Ponding	1
717	Owatonna	Yes	No	Yes	0.6	1	1.0	Yes	Yes	1.0	Yes	Yes	Yes	Yes	Good	No flares	Some Dirt/ ponding, one flare	1
718	Owatonna	Yes	No	Yes	0.2	1	0.6	Yes	Yes	0.6		Yes	Yes	Yes	Good	No flares		1
719	Owatonna	Yes	Yes	Yes	5.3	No	2.4	Yes	Yes	1.7		N/A			Good	No flares needed		0
720	Owatonna	Yes	Yes	Yes	2.6	No	3.4	Yes	No	2.2		N/A		1	Good	No flares needed		0
721	Owatonna	Yes	Yes	Yes	7.9	No	4.8	Yes	Yes	1.8		N/A			Good	No flares needed		0
722	Owatonna	Yes	Yes	Yes	1.5	No	5.0	Yes	No	3.0		N/A			Good	No flares needed		0
723	Owatonna	Yes	Yes	Yes	6.8	No	4.6	Yes	No	3.1		N/A			Good	No flares needed		0
724	Owatonna	Yes	Yes	Yes	1.8	No	4.3	Yes	No	2.7		N/A			Fair	No flares needed	Some veg	0
725	Owatonna	Yes	Yes	No	8.9	No	3.7	Yes	No	3.3		N/A			Good	No flares needed	Some ruined pavement	0
726	Owatonna	Yes	Yes	Yes	1.1	No	3.3	Yes	No	3.1		N/A			Good	No flares needed		0
727	Owatonna	Yes	Yes	Yes	8.2	No	3.3	Yes	No	2.7		N/A			Good	No flares needed		0
728	Owatonna	Yes	Yes	Yes	1.4	No	4.0	Yes	No	3.6		N/A			Good	No flares needed		0
729	Owatonna	Yes	Yes	No	8.6	No	2.1	Yes	No	3.6		N/A			Good	No flares needed		0
730	Owatonna	Yes	Yes	Yes	1.3	No	2.4	Yes	No	3.4		N/A			Good	No flares needed		0
731	Owatonna	Yes	Yes	No	9.0	No	3.3	Yes	No	4.2		N/A			Good	No flares needed		0
732	Owatonna	Yes	Yes	Yes	1.4	No	2.9	Yes	No	2.9		N/A			Good	No flares needed	Crack	0
733	Owatonna	Yes	Yes	No	9.8	No	2.1	Yes	No	4.3		N/A			Good	No flares needed		0
734	Owatonna	Yes	Yes	Yes	0.3	No	2.7	Yes	No	4.1		N/A			Good	No flares needed		0
735	Owatonna	Yes	Yes	No	10.7	No	3.0	Yes	No	3.8		N/A			Good	No flares needed		0
736	Owatonna	Yes	Yes	Yes	0.5	No	2.6	No	No	2.6		N/A			Good	No flares needed		0
737	Owatonna	Yes	Yes	Yes	6.4	No	2.2	Yes	No	4.0		N/A			Fair	No flares needed	Crack	0
738	Owatonna	Yes	Yes	Yes	0.2	No	2.5	Yes	No	2.5		Yes			Good	No flares needed		0
739	Owatonna	Yes	Yes	Yes	6.2	1	1.8	Yes	No	3.1		N/A			Good	No flares needed		0
740	Owatonna	Yes	Yes	Yes	2.5	No	2.4	Yes	No	2.3		N/A			Good	No flares needed		0
741	Owatonna	Yes	Yes	Yes	6.3	No	4.4	Yes	No	2.4		N/A			Good	No flares needed		0
742	Owatonna	Yes	Yes	Yes	2.3	No	3.8	Yes	Yes	1.6		N/A			Good	No flares needed		0
743	Owatonna	Yes	Yes	Yes	5.6	No	3.3	Yes	Yes	1.4		N/A			Good	No flares needed		0
744	Owatonna	Yes	Yes	Yes	3.5	No	2.1	Yes	Yes	0.9		N/A			Good	No flares needed		0
745	Owatonna	Yes	Yes	Yes	5.3	No	2.9	Yes	Yes	1.1		N/A			Good	No flares needed		0
746	Owatonna	Yes	Yes	Yes	3.5	No	3.9	Yes	Yes	1.0		N/A			Good	No flares needed		0
747	Owatonna	Yes	No	Yes	6.3	1	0.1	Yes	Yes	0.8	Yes	No			Good			0
748	Owatonna	Yes	No	Yes	5.2	1	0.8	Yes	Yes	0.2	Yes	No			Good			0
749	Owatonna	Yes	Yes	Yes	3.3	No	2.3	Yes	Yes	1.8		N/A			Good	No flares needed		0
750	Owatonna	Yes	Yes	Yes	4.7	No	3.6	Yes	Yes	1.3		N/A			Good	No flares needed		0
751	Owatonna	Yes	Yes	Yes	3.9	No	3.4	Yes	Yes	1.6		N/A			Fair	No flares needed	Veg	0
752	Owatonna	Yes	Yes	Yes	5.8	No	3.4	Yes	Yes	1.5		N/A			Good	No flares needed		0
753	Owatonna	Yes	Yes	Yes	1.4	No	3.7	Yes	Yes	1.3		N/A			Good	No flares needed		0
754	Owatonna	Yes	Yes	Yes	5.6	No	4.1	Yes	Yes	1.4		N/A			Good	No flares needed		0
755	Owatonna	Yes	Yes	Yes	3.6	No	3.9	Yes	Yes	1.7		N/A			Good	No flares needed		0
756	Owatonna	Yes	Yes	Yes	5.4	No	4.1	Yes	Yes	1.7		N/A			Good	No flares needed		0
757	Owatonna	Yes	Yes	Yes	3.4	1	1.1	Yes	Yes	1.1		N/A			Good	No flares needed		1
758	Owatonna	Yes	Yes	Yes	6.0	No	3.4	Yes	Yes	1.3		N/A			Good	No flares needed		0
759	Owatonna	Yes	Yes	Yes	8.3	No	2.3	Yes	Yes	0.6		N/A			Good			0
760	Owatonna	Yes	No	No	11.1	No	3.3	Yes	Yes	1.8	No	No			Good			0
761	Owatonna	Yes	Yes	Yes	4.7	No	4.7	Yes	Yes	1.6		N/A			Good	No flares needed		0
762	Owatonna	Yes	Yes	Yes	3.8	No	4.1	Yes	No	2.1		N/A			Good	No flares needed		0
763	Owatonna	Yes	Yes	Yes	2.2	No	7.3	Yes	No	2.9		N/A			Good	No flares needed		0
764	Owatonna	Yes	Yes	Yes	5.3	No	3.2	Yes	Yes	1.2		N/A			Good	No flares needed		0
765	Owatonna	Yes	Yes	Yes	6.5	No	4.0	Yes	Yes	1.0		N/A			Good	No flares needed		0
766	Owatonna	Yes	Yes	Yes	3.4	No	3.5	Yes	Yes	1.7		N/A			Good	No flares needed		0
767	Owatonna	Yes	Yes	Yes	2.7	No	3.6	Yes	Yes	1.0		N/A			Good	No flares needed		0
768	Owatonna	Yes	Yes	Yes	2.2	No	2.7	Yes	No	2.5		N/A			Good	No flares needed		0
769	Owatonna	Yes	No	Yes	7.0	1	0.5	Yes	No	2.6		No			Fair	Ponding		0
770	Owatonna	Yes	No	Yes	5.0	1	0.4	Yes	0	1.4		No			Fair	Ponding		0
771	Owatonna	Yes	Yes	Yes	6.1	No	4.4	Yes	No	2.3		N/A			Good	No flares needed		0
772	Owatonna	Yes	Yes	Yes	2.7	No	3.2	Yes	Yes	1.1		N/A			Good	No flares needed		0
773	Owatonna	Yes	Yes	Yes	5.3	1	2.0	Yes	Yes	1.0		N/A			Good	No flares needed		1
774	Owatonna	Yes	Yes	Yes	2.9	1	1.8	Yes	Yes	1.3		N/A			Good	No flares needed		1
775	Owatonna	Yes	No	Yes	6.9	1	0.7	Yes	Yes	2.0	Yes	No			Good			0
776	Owatonna	Yes	No	Yes	6.5	1	0.4	Yes	No	2.8	Yes	No			Good			0
777	Owatonna	Yes	Yes	Yes	4.4	1	2.0	Yes	No	2.1		N/A			Good	No flares needed	Some veg	0
778	Owatonna	Yes	Yes	Yes	2.8	1	1.8	Yes	Yes	1.8		N/A			Good	No flares needed		1
779	Owatonna	Yes	Yes	Yes	3.2	No	3.9	Yes	Yes	1.7		N/A			Good	No flares needed		0
780	Owatonna	Yes	Yes	Yes	3.0	No	4.2	Yes	Yes	1.2		N/A			Fair	No flares needed	Some veg	0
781	Owatonna	Yes	No	Yes	2.6	No	2.9	Yes	Yes	1.5	Yes	Yes	Yes	Yes	Good		One flare	0
782	Owatonna	Yes	No	Yes	2.1	1	1.1	Yes	Yes	1.6	Yes	Yes	Yes	Yes	Good		One flare	1
783	Owatonna	Yes	No	Yes	1.5	No	2.4	Yes	Yes	1.7	Yes	Yes	Yes	Yes	Fair	Ponding	One flare	0
784	Owatonna	Yes	No	Yes	3.1	1	0.9	Yes	Yes	0.8	Yes	Yes	Yes	Yes	Good		One flare	1
785	Owatonna	Yes	Yes	Yes	4.2	No	3.1	Yes	Yes	1.1		N/A			Fair	No flares needed	Some veg	0
786	Owatonna	Yes	Yes	Yes	5.1	No	3.3	Yes	Yes	1.4		N/A			Good	No flares needed		0
787	Owatonna	Yes	Yes	Yes	4.3	No	3.5	Yes	Yes	1.6		N/A			Good	No flares needed		0
788	Owatonna	Yes	Yes	Yes	5.2	No	3.7	Yes	Yes	1.9		N/A			Good	No flares needed		0
789	Owatonna	Yes	Yes	Yes	3.5	No	4.9	Yes	Yes	1.9		N/A			Good	No flares needed		0
790	Owatonna	Yes	Yes	Yes	5.6	No	3.1	Yes	Yes	2.0		N/A			Fair	No flares needed	Some veg	0

OBJECTID	City	If walk/trail crosses curb, is there a curb ramp?	Is the Curb Ramp at a Driveway	Running slope <= 8.3%?	What is the running slope of the curb ramp?	Cross slope, excluding flares, <= 2%?	What is the cross slope of the curb ramp?	Curb ramp, excluding flares, at least 48in wide?	Landing >= 48in sq with cross slope <2% any dir?	What is the max landing slope?	Curb ramp flares slopes <= 10%?	Detectable warnings full width of the curb ramp?	Approx 75% of truncated domes in good condition?	Truncated domes contrast w/ adjacent surfaces?	Curb Ramp overall condition?	CR_Characteristics	Notes	Compliant 1=Compliant
791	Owatonna	Yes	Yes	Yes	3.5	No	3.3	Yes	Yes	1.3		N/A			Good	No flares needed		0
792	Owatonna	Yes	Yes	Yes	5.4	No	3.6	Yes	Yes	1.5		N/A			Good	No flares needed		0
793	Owatonna	Yes	Yes	Yes	0.2	No	5.2	Yes	No	2.5		N/A			Good	No flares needed		0
794	Owatonna	Yes	Yes	Yes	7.7	No	4.0	Yes	No	3.8		N/A			Good	No flares needed		0
795	Owatonna	Yes	Yes	Yes	0.6	No	3.5	Yes	No	3.5		N/A			Good	No flares needed		0
796	Owatonna	Yes	Yes	Yes	7.4	No	4.1	Yes	No	4.6		N/A			Good	No flares needed	Ponding	0
797	Owatonna	Yes	Yes	Yes	1.5	No	5.6	Yes	No	4.3		N/A			Good	No flares needed		0
798	Owatonna	Yes	Yes	Yes	7.1	1	1.2	Yes	No	3.9		N/A			Good	No flares needed		0
799	Owatonna	Yes	Yes	Yes	5.0	1	1.3	Yes	No	3.5	N/A	N/A			Fair	Some cracking and vegetation		0
800	Owatonna	Yes	No	No	9.1	1	1.9	Yes	No	2.8	Yes	No			Fair	Some cracking		0
801	Owatonna	Yes	Yes	Yes	0.6	No	2.2	Yes	No	2.2		N/A			Good	No flares needed		0
802	Owatonna	Yes	Yes	Yes	7.4	No	2.4	Yes	No	3.9		N/A			Good	No flares needed		0
803	Owatonna	Yes	Yes	Yes	0.0	No	4.8	Yes	No	3.0		N/A			Good	No flares needed		0
804	Owatonna	Yes	Yes	No	8.5	1	0.4	Yes	No	4.0		N/A			Good	No flares needed		0
805	Owatonna	Yes	Yes	Yes	0.6	No	3.9	Yes	No	3.0		N/A			Good	No flares needed		0
806	Owatonna	Yes	Yes	Yes	7.5	No	3.0	Yes	No	3.8		N/A			Good	No flares needed		0
807	Owatonna	Yes	No	Yes	5.7	1	1.1	No	Yes	0.9	Yes	No			Good		Gap in elevation	0
808	Owatonna	Yes	No	Yes	7.8	No	2.4	Yes	Yes	0.9	Yes	No			Good			0
809	Owatonna	Yes	No	Yes	5.4	1	0.9	Yes	Yes	1.5	Yes	No			Fair	Some cracking	Gap in elevation	0
810	Owatonna	Yes	No	Yes	7.0	1	0.1	Yes	Yes	1.4	Yes	No			Fair	Ponding		0
811	Owatonna	Yes	Yes	Yes	4.5	1	1.7	Yes	Yes	1.4	Yes	N/A			Good	Manhole		1
812	Owatonna	Yes	No	Yes	7.4	1	1.1	Yes	Yes	1.8	No	No			Fair	Some cracking	Gap in elevation	0
813	Owatonna	Yes	No	No	8.4	1	0.8	Yes	Yes	1.9	Yes	No			Fair	Ponding	Some cracking	0
814	Owatonna	Yes	No	Yes	7.7	1	1.7	Yes	Yes	1.9	Yes	No			Fair	Some cracking		0
815	Owatonna	Yes	No	Yes	6.6	1	0.7	Yes	Yes	1.1	Yes	Yes	Yes	Yes	Fair	Some cracking	Broken flare	1
816	Owatonna	Yes	No	Yes	5.6	1	0.6	Yes	Yes	0.8	Yes	No			Good			0
817	Owatonna	Yes	No	Yes	2.8	No	2.5	Yes	Yes	1.8	Yes	Yes	Yes	Yes	Good		Man hole and fire hydrant	0
818	Owatonna	Yes	No	Yes	6.5	1	0.1	Yes	Yes	0.8	Yes	No			Good			0
819	Owatonna	Yes	No	Yes	4.7	No	5.0	Yes	Yes	0.7	Yes	No			Good			0
820	Owatonna	Yes	No	Yes	4.6	No	4.5	Yes	Yes	0.6	Yes	No			Good			0
821	Owatonna	Yes	Yes	Yes	4.2	1	0.1	Yes	Yes	0.6	Yes	N/A			Good			1
822	Owatonna	Yes	No	Yes	7.2	1	0.8	Yes	Yes	1.8	Yes	No			Fair	Some vegetation		0
823	Owatonna	Yes	No	Yes	0.9	No	4.2	Yes	Yes	1.8	Yes	No			Good			0
824	Owatonna	Yes	No	Yes	2.1	No	2.2	Yes	Yes	1.0	Yes	No			Good			0
825	Owatonna	Yes	No	Yes	1.9	1	0.8	Yes	Yes	1.0	Yes	No			Good			0
826	Owatonna	Yes	No	Yes	5.9	1	0.7	Yes	No	2.3	No	No			Good		Man hole	0
827	Owatonna	Yes	No	Yes	2.2	No	4.3	Yes	No	2.3	No	No			Fair	Some vegetation		0
828	Owatonna	Yes	No	Yes	5.2	1	0.1	Yes	Yes	1.7	Yes	No			Fair	Ponding	Some veg	0
829	Owatonna	Yes	Yes	Yes	5.8	1	0.8	Yes	Yes	0.5	Yes	N/A			Good	Some vegetation		1
830	Owatonna	Yes	No	Yes	4.4	0	0.6	Yes	Yes	1.7	No	No			Fair	Heavy vegetation		0
831	Owatonna	Yes	No	Yes	0.6	1	0.6	Yes	Yes	0.6	No	No			Fair	Ponding		0
832	Owatonna	Yes	No	Yes	3.6	1	1.0	Yes	Yes	1.3	Yes	Yes	Yes	Yes	Good			1
833	Owatonna	Yes	No	Yes	5.5	1	0.2	Yes	Yes	1.0	Yes	No	Yes	Yes	Fair		Broken warnings , one flare	0
834	Owatonna	Yes	No	Yes	4.8	No	4.9	Yes	No	2.4	Yes	Yes	No	Yes	Fair	Ponding		0
835	Owatonna	Yes	No	Yes	3.8	No	2.4	Yes	Yes	1.0	Yes	No	No	Yes	Fair	Some vegetation	No dots on contrasted spot	0
836	Owatonna	Yes	No	Yes	3.5	1	0.7	Yes	Yes	0.8	Yes	Yes			Fair	Some vegetation	Some ponding	1
837	Owatonna	Yes	No	Yes	5.9	1	0.1	Yes	Yes	1.2	Yes	Yes	No	Yes	Fair	Some vegetation		0
838	Owatonna	Yes	Yes	Yes	3.0	1	0.7	Yes	No	3.0	Yes	N/A	Yes	Yes	Good	Some ponding and vegetation		0
839	Owatonna	Yes	No	Yes	2.8	1	2.0	Yes	Yes	1.8	Yes	Yes	Yes	Yes	Good			1
840	Owatonna	Yes	No	Yes	4.8	1	0.9	Yes	No	2.3	Yes	No			Good			0
841	Owatonna	Yes	No	Yes	4.2	1	1.4	Yes	Yes	1.8	Yes	No			Good			0
842	Owatonna	Yes	No	Yes	3.0	1	0.6	Yes	Yes	1.9	Yes	No			Good			0
843	Owatonna	Yes	No	No	9.6	1	0.8	Yes	No	2.9	Yes	No			Good			0
844	Owatonna	Yes	No	Yes	5.1	No	3.8	Yes	No	2.9	Yes	No			Good			0
845	Owatonna	Yes	No	Yes	0.5	1	1.4	Yes	Yes	1.4	Yes	No			Good			0
846	Owatonna	Yes	No	Yes	3.4	No	3.7	Yes	Yes	1.6	No	No			Good			0
847	Owatonna	Yes	No	Yes	1.1	No	2.2	Yes	Yes	1.8	Yes	Yes	No	Yes	Fair	Ponding		0
848	Owatonna	Yes	No	Yes	2.7	No	4.7	No	Yes	1.7	Yes	Yes	No	Yes	Fair	Some vegetation		0
849	Owatonna	Yes	No	Yes	0.9	No	3.4	Yes	Yes	1.7	Yes	Yes	No	Yes	Fair	Ponding		0
850	Owatonna	Yes	No	Yes	2.7	1	0.4	Yes	Yes	1.5	Yes	No			Good			0
851	Owatonna	Yes	No	Yes	5.6	No	2.8	Yes	Yes	2.0	Yes	No			Fair		Crack and small ponding	0
852	Owatonna	Yes	Yes	Yes	3.1	1	1.3	Yes	Yes	1.3		Yes			Good	No flares needed		1
853	Owatonna	Yes	Yes	Yes	4.7	1	1.3	Yes	No	2.4		N/A			Fair	No flares needed	Some cracking	0
854	Owatonna	Yes	Yes	Yes	5.0	No	5.0	Yes	No	3.6		N/A			Good	No flares needed		0
855	Owatonna	Yes	Yes	Yes	4.9	No	2.8	Yes	No	4.7		N/A			Good	No flares needed		0
856	Owatonna	Yes	Yes	Yes	2.2	No	7.0	Yes	No	4.5		N/A			Good	No flares needed		0
857	Owatonna	Yes	Yes	Yes	5.7	No	5.4	Yes	Yes	1.6		N/A			Good	No flares needed		0
858	Owatonna	Yes	No	Yes	2.3	1	0.4	Yes	Yes	0.8	Yes	Yes	Yes	Yes	Good	Ponding		1
859	Owatonna	Yes	No	Yes	4.4	1	1.0	Yes	Yes	0.6	Yes	Yes	Yes	Yes	Good			1
860	Owatonna	Yes	No	Yes	3.9	1	0.3	Yes	Yes	0.6	Yes	Yes	Yes	Yes	Good			1
861	Owatonna	Yes	Yes	Yes	1.9	0	1.9	Yes	Yes	1.9		N/A			Good	No flares needed		1
862	Owatonna	Yes	Yes	Yes	4.8	No	2.8	Yes	No	2.5		N/A			Good	No flares needed		0
863	Owatonna	Yes	No	Yes	8.3	No	3.5	No	No	2.8	No	No			Good		Man hole	0
864	Owatonna	Yes	No	Yes	4.0	1	0.4	No	Yes	1.3	Yes	No			Good			0
865	Owatonna	Yes	No	Yes	5.4	1	1.4	Yes	Yes	0.9	Yes	No			Good			0
866	Owatonna	Yes	No	Yes	3.4	1	0.3	Yes	Yes	1.9	Yes	Yes	Yes	Yes	Good			1
867	Owatonna	Yes	No	Yes	3.3	No	2.9	Yes	Yes	1.7	Yes	No			Good			0
868	Owatonna	Yes	No	Yes	6.5	No	2.7	Yes	Yes	1.4	Yes	No			Good			0
869	Owatonna	Yes	Yes	Yes	3.7	No	2.3	Yes	Yes	0.8		N/A			Fair	No flares needed	Gap in elevation	0
870	Owatonna	Yes	Yes	Yes	2.9	No	2.4	Yes	Yes	1.6		N/A			Good	No flares needed	Crack	0
871	Owatonna	Yes	No	Yes	1.6	1	0.5	Yes	Yes	1.6	Yes	Yes	Yes	Yes	Good			1

OBJECTID	City	If walk/trail crosses curb, is there a curb ramp?	Is the Curb Ramp at a Driveway	Running slope <= 8.3%?	What is the running slope of the curb ramp?	Cross slope, excluding flares, <= 2%?	What is the cross slope of the curb ramp?	Curb ramp, excluding flares, at least 48in wide?	Landing >= 48in sq with cross slope <2% any dir?	What is the max landing slope?	Curb ramp flares slopes <= 10%?	Detectable warnings full width of the curb ramp?	Approx 75% of truncated domes in good condition?	Truncated domes contrast w/ adjacent surfaces?	Curb Ramp overall condition?	CR Characteristics	Notes	Compliant 1=Compliant
872	Owatonna	Yes	No	Yes	0.8	1	1.0	Yes	Yes	1.0	Yes	Yes	Yes	Yes	Good			1
873	Owatonna	Yes	Yes	Yes	1.0	No	4.4	Yes	Yes	1.7		N/A			Good	No flares needed		0
874	Owatonna	Yes	Yes	Yes	3.3	No	3.5	Yes	No	3.4		N/A			Fair	No flares needed	Some ponding	0
875	Owatonna	Yes	No	Yes	5.0	No	2.4	Yes	No	3.9	Yes	No			Good		Broken flare	0
876	Owatonna	Yes	No	Yes	7.2	1	0.0	Yes	Yes	1.8	No	No			Fair	Ponding	Broken flares	0
877	Owatonna	Yes	No	No	9.1	1	1.1	Yes	Yes	0.8	Yes	No			Good			0
878	Owatonna	Yes	Yes	Yes	0.2	1	0.9	Yes	Yes	0.9		N/A			Good	No flares needed		1
879	Owatonna	Yes	Yes	Yes	5.1	No	3.6	Yes	No	3.2		N/A			Good	No flares needed		0
880	Owatonna	Yes	No	Yes	1.6	1	0.5	Yes	Yes	1.6	Yes	Yes	Yes	Yes	Good			1
881	Owatonna	Yes	No	Yes	3.7	1	0.4	Yes	Yes	0.9	Yes	Yes	Yes	Yes	Good			1
882	Owatonna	Yes	No	Yes	4.0	1	0.8	Yes	Yes	0.9	Yes	Yes	Yes	Yes	Good			1
883	Owatonna	Yes	Yes	Yes	1.8	No	4.0	Yes	No	3.1		N/A			Fair	No flares needed	Crack	0
884	Owatonna	Yes	Yes	Yes	4.0	0	1.7	Yes	No	4.0		N/A			Fair	No flares needed	Crack	0
885	Owatonna	Yes	No	Yes	2.8	1	0.2	Yes	Yes	1.8	Yes	Yes	Yes	Yes	Good			1
886	Owatonna	Yes	Yes	Yes	3.3	0	0.2	Yes	Yes	1.0	Yes	Yes	Yes	Yes	Fair	Some cracking		1
887	Owatonna	Yes	Yes	Yes	2.3	No	3.4	Yes	Yes	0.9		N/A			Good	No flares needed		0
888	Owatonna	Yes	Yes	Yes	1.5	No	2.2	Yes	Yes	2.0		N/A			Good	No flares needed		0
889	Owatonna	Yes	No	Yes	1.7	1	0.6	Yes	Yes	1.7	Yes	Yes	Yes	Yes	Good			1
890	Owatonna	Yes	No	Yes	1.8	1	1.1	Yes	Yes	1.8	Yes	Yes	Yes	Yes	Good			1
891	Owatonna	Yes	No	Yes	4.5	1	0.9	Yes	Yes	1.1	Yes	Yes	Yes	Yes	Good			1
892	Owatonna	Yes	No	Yes	4.9	1	0.1	Yes	Yes	0.6	Yes	Yes	Yes	Yes	Good			1
893	Owatonna	Yes	Yes	Yes	4.0	1	0.2	Yes	Yes	0.6	Yes	Yes	Yes	Yes	Good			1
894	Owatonna	Yes	No	Yes	4.1	1	0.4	Yes	Yes	0.8	Yes	Yes	Yes	Yes	Good			1
895	Owatonna	Yes	No	Yes	1.2	1	0.7	Yes	Yes	1.2	Yes	Yes	Yes	Yes	Good			1
896	Owatonna	Yes	No	Yes	2.3	1	0.5	Yes	Yes	0.7	Yes	Yes	Yes	Yes	Good			1
897	Owatonna	Yes	No	Yes	4.4	1	0.3	Yes	Yes	0.7	Yes	Yes	Yes	Yes	Good			1
898	Owatonna	Yes	No	Yes	4.1	1	0.2	Yes	Yes	1.3	Yes	Yes	Yes	Yes	Good			1
899	Owatonna	Yes	No	Yes	3.1	0	0.4	Yes	Yes	0.1	Yes	Yes	Yes	Yes	Good	Under construction	Dirty	1
900	Owatonna	Yes	Yes	Yes	1.9	1	0.9	Yes	Yes	0.9	Yes	Yes	Yes	Yes	Good	Under construction		1
901	Owatonna	Yes	No								No	Yes	Yes	Yes	Good	Under construction		0
902	Owatonna	Yes	No	Yes	1.2	1	0.7	Yes	Yes	1.2	Yes	Yes	Yes	Yes	Good	Under construction		1
903	Owatonna	Yes	No	Yes	0.7	1	0.2	Yes	Yes	0.7		Yes	Yes	Yes	Good	No flares needed	Train track	1
904	Owatonna	Yes	No	Yes	0.3	1	0.7	Yes	Yes	0.7		Yes	Yes	Yes	Good	No flares needed	Train	1
905	Owatonna	Yes	No	Yes	2.5	1	0.2	Yes	Yes	0.5	Yes	Yes	Yes	Yes	Good	Under construction		1
906	Owatonna	Yes	No	Yes	0.3	1	0.8	Yes	Yes	0.5	Yes	Yes	Yes	Yes	Good	Under construction		1
907	Owatonna	Yes	No	Yes	3.9	1	0.0	Yes	Yes	0.7	Yes	Yes	Yes	Yes	Good			1
908	Owatonna	Yes	No	Yes	1.4	1	0.6	Yes	Yes	1.4	Yes	Yes	Yes	Yes	Good	Under construction		1
909	Owatonna	Yes	No	Yes	3.8	1	0.8	Yes	Yes	0.8	Yes	Yes	Yes	Yes	Good	Under construction		1
910	Owatonna	Yes	No	Yes	2.6	1	0.2	Yes	Yes	0.9	Yes	Yes	Yes	Yes	Good	Under construction		1
911	Owatonna	Yes	No	Yes	4.0	1	0.4	Yes	Yes	0.6	Yes	Yes	Yes	Yes	Good	Ponding		1
912	Owatonna	Yes	No	Yes	3.7	1	0.8	Yes	Yes	0.6	Yes	Yes	Yes	Yes	Good	Under construction		1
913	Owatonna	Yes	Yes	Yes	0.7	No	6.6	Yes	No	3.8		N/A			Good	No flares needed		0
914	Owatonna	Yes	Yes	Yes	2.9	1	1.8	Yes	No	2.5		N/A			Good	No flares needed		0
915	Owatonna	Yes	Yes	Yes	0.3	No	4.8	No	No	2.5		N/A			Good	No flares needed		0
916	Owatonna	Yes	Yes	Yes	3.3	No	5.6	Yes	Yes	1.6		N/A			Good	No flares needed		0
917	Owatonna	Yes	Yes	Yes	1.4	No	5.3	Yes	Yes	1.0		N/A			Good	No flares needed		0
918	Owatonna	Yes	Yes	Yes	2.2	No	7.2	Yes	Yes	0.7		N/A			Good	No flares needed		0
919	Owatonna	Yes	Yes	Yes	1.4	No	3.9	Yes	Yes	1.9		N/A			Good	No flares needed		0
920	Owatonna	Yes	Yes	Yes	3.1	0	2.9	Yes	No	2.4		N/A			Good	No flares needed		0
921	Owatonna	Yes	No	Yes	0.8	1	0.9	Yes	Yes	0.9	Yes	Yes	Yes	Yes	Good			1
922	Owatonna	Yes	No	Yes	4.5	1	1.2	Yes	Yes	0.6	Yes	Yes	Yes	Yes	Good	Under construction		1
923	Owatonna	Yes	Yes	Yes	0.8	No	3.0	Yes	No	2.2		N/A			Fair	No flares needed		0
924	Owatonna	Yes	Yes	Yes	0.4	No	6.3	Yes	Yes	1.4		N/A			Good	No flares needed		0
925	Owatonna	Yes	Yes	Yes	3.0	No	3.1	Yes	Yes	1.3		N/A			Good	No flares needed		0
926	Owatonna	Yes	Yes	Yes	1.8	No	3.1	Yes	No	3.0		N/A			Good	No flares needed		0
927	Owatonna	Yes	No	Yes	5.4	1	0.5	Yes	Yes	0.5	Yes	No			Good			0
928	Owatonna	Yes	No	Yes	3.5	1	1.4	Yes	Yes	2.0	Yes	No			Good			0
929	Owatonna	Yes	No	Yes	6.5	No	3.5	Yes	No	2.4	Yes	No			Good		Grate openings	0
930	Owatonna	Yes	No	Yes	4.8	1	1.6	Yes	No	2.4	Yes	No			Good			0
931	Owatonna	Yes	No	Yes	4.0	1	0.8	Yes	Yes	1.0	Yes	No			Good			0
932	Owatonna	Yes	No	Yes	4.3	1	1.6	Yes	Yes	0.8	Yes	No			Good	Ponding		0
933	Owatonna	Yes	Yes	Yes	4.5	1	0.6	Yes	Yes	1.3	Yes	N/A			Good			1
934	Owatonna	Yes	No	Yes	5.2	1	0.4	Yes	Yes	0.2	Yes	No			Good			0
935	Owatonna	Yes	No	Yes	4.5	1	2.0	Yes	Yes	1.4	Yes	No			Good			0
936	Owatonna	Yes	Yes	Yes	2.0	1	1.5	Yes	Yes	2.0		N/A			Good	No flares needed		1
937	Owatonna	Yes	Yes	Yes	3.9	No	2.3	Yes	Yes	1.9		N/A			Good	No flares needed		0
938	Owatonna	Yes	Yes	Yes	0.5	No	5.0	Yes	No	2.2		N/A			Good	No flares needed		0
939	Owatonna	Yes	Yes	Yes	2.4	No	6.0	Yes	Yes	1.5		N/A			Good	No flares needed		0
940	Owatonna	Yes	Yes	Yes	0.0	No	2.8	Yes	Yes	1.5		N/A			Good	No flares needed		0
941	Owatonna	Yes	Yes	Yes	4.4	No	3.2	Yes	Yes	1.4		N/A			Good	No flares needed		0
942	Owatonna	Yes	No	Yes	2.8	1	0.4	Yes	No	2.3	Yes	No	Yes	Yes	Good		One flare	0
943	Owatonna	Yes	No	Yes	1.9	1	0.8	Yes	Yes	1.9	Yes	No	Yes	Yes	Good		One flare	0
944	Owatonna	Yes	No	Yes	0.8	1	0.0	Yes	Yes	0.8	Yes	No	Yes	Yes	Good		One flare, little ponding	0
945	Owatonna	Yes	No	Yes	0.9	1	1.0	Yes	Yes	1.0	Yes	No	Yes	Yes	Good		One flare	0
946	Owatonna	Yes	No	Yes	2.9	1	1.0	Yes	No	2.9	Yes	No	Yes	Yes	Good		One flare	0
947	Owatonna	Yes	No	Yes	1.1	No	2.5	Yes	Yes	0.7	Yes	Yes	Yes	Yes	Fair	Some vegetation		0
948	Owatonna	Yes	No	Yes	0.1	1	2.0	Yes	Yes	2.0	Yes	Yes	Yes	Yes	Fair		Gap in elevation	1
949	Owatonna	Yes	No	Yes	0.5	1	1.3	Yes	Yes	1.3	Yes	Yes	Yes	Yes	Good			1
950	Owatonna	Yes	No	Yes	4.2	1	1.0	Yes	Yes	0.9	Yes	Yes	Yes	Yes	Good			1
951	Owatonna	Yes	No	Yes	4.8	1	0.2	Yes	Yes	0.9	Yes	Yes	Yes	Yes	Good		Some ponding	1
952	Owatonna	Yes	Yes	Yes	5.0	No	5.9	Yes	Yes	2.0		N/A			Good	No flares needed		0

OBJECTID	City	If walk/trail crosses curb, is there a curb ramp?	Is the Curb Ramp at a Driveway	Running slope <= 8.3%?	What is the running slope of the curb ramp?	Cross slope, excluding flares, <= 2%?	What is the cross slope of the curb ramp?	Curb ramp, excluding flares, at least 48in wide?	Landing >= 48in sq with cross slope <2% any dir?	What is the max landing slope?	Curb ramp flares slopes <= 10%?	Detectable warnings full width of the curb ramp?	Approx 75% of truncated domes in good condition?	Truncated domes contrast w/ adjacent surfaces?	Curb Ramp overall condition?	CR Characteristics	Notes	Compliant 1=Compliant
953	Owatonna	Yes	Yes	Yes	3.6	No	6.7	Yes	Yes	1.2		N/A			Good	No flares needed		0
954	Owatonna	Yes	No	Yes	0.5	1	1.2	Yes	Yes	1.2	Yes	Yes	Yes	Yes	Good			1
955	Owatonna	Yes	No	Yes	0.9	1	0.7	Yes	Yes	0.9	Yes	Yes	Yes	Yes	Good			1
956	Owatonna	Yes	Yes	Yes	2.4	No	2.5	Yes	Yes	1.5		N/A			Good	No flares needed		0
957	Owatonna	Yes	Yes	Yes	1.0	No	2.2	Yes	Yes	0.7		N/A			Good	No flares needed		0
958	Owatonna	Yes	No	Yes	1.9	1	0.9	Yes	Yes	1.9	Yes	Yes	Yes	Yes	Good			1
959	Owatonna	Yes	No	Yes	2.3	1	0.1	Yes	Yes	0.6	Yes	Yes	Yes	Yes	Good			1
960	Owatonna	Yes	No	Yes	4.5	1	0.6	Yes	Yes	0.7	Yes	Yes	Yes	Yes	Good			1
961	Owatonna	Yes	No	Yes	4.5	1	0.1	Yes	Yes	0.6	Yes	Yes	Yes	Yes	Good			1
962	Owatonna	Yes	Yes	Yes	3.1	1	0.2	Yes	Yes	1.2	Yes	Yes	Yes	Yes	Good			1
963	Owatonna	Yes	No	Yes	3.7	1	0.5	Yes	Yes	0.9	Yes	Yes	Yes	Yes	Good			1
964	Owatonna	Yes	No	Yes	3.0	1	0.9	Yes	Yes	1.5	Yes	No			Fair	Ponding		0
965	Owatonna	Yes	No	Yes	0.1	1	1.6	Yes	Yes	1.6	Yes	No			Good			0
966	Owatonna	Yes	No	Yes	6.2	No	2.4	Yes	Yes	1.6	Yes	No			Good			0
967	Owatonna	Yes	No	Yes	3.0	1	1.3	Yes	Yes	1.3	Yes	No			Fair	Some vegetation		0
968	Owatonna	Yes	No	Yes	5.1	1	0.8	Yes	Yes	0.6	Yes	Yes	Yes	Yes	Good			1
969	Owatonna	Yes	No	Yes	4.3	No	3.9	Yes	Yes	1.4	Yes	Yes	Yes	Yes	Fair	Ponding		0
970	Owatonna	Yes	Yes	Yes	2.3	No	3.2	Yes	Yes	0.9		N/A			Good	No flares needed		0
971	Owatonna	Yes	Yes	Yes	0.3	No	3.4	Yes	Yes	1.4		N/A			Good	No flares needed		0
972	Owatonna	Yes	No	Yes	5.9	1	0.3	Yes	Yes	1.6	Yes	Yes	Yes	Yes	Good	Some ponding and vegetation		1
973	Owatonna	Yes	No	Yes	4.1	1	1.1	Yes	Yes	1.5	Yes	Yes	Yes	Yes	Poor	Some ponding and vegetation		0
974	Owatonna	Yes	No	Yes	3.3	1	1.0	No	No	3.0	Yes	Yes	Yes	Yes	Fair	Some vegetation		0
975	Owatonna	Yes	No	Yes	6.0	1	1.0	Yes	Yes	1.6	Yes	Yes	Yes	Yes	Good			1
976	Owatonna	Yes	No	Yes	4.0	No	3.7	Yes	Yes	1.5	Yes	Yes	Yes	Yes	Good			0
977	Owatonna	Yes	No	Yes	3.8	No	3.1	Yes	Yes	1.0	Yes	Yes	Yes	Yes	Good		Some branches in the way	0
978	Owatonna	Yes	Yes	Yes	0.6	No	3.7	Yes	Yes	1.4		N/A			Good	No flares needed		0
979	Owatonna	Yes	Yes	Yes	1.7	No	4.8	Yes	Yes	2.0		N/A			Good	No flares needed		0
980	Owatonna	Yes	No	Yes	5.5	No	5.1	Yes	No	3.0	Yes	No			Fair	Some vegetation		0
981	Owatonna	Yes	No	Yes	4.8	1	0.4	Yes	No	2.3	Yes	No			Good			0
982	Owatonna	Yes	Yes	Yes	1.1	1	1.4	Yes	Yes	1.4		Yes	Yes	Yes	Good	No flares needed		1
983	Owatonna	Yes	Yes	Yes	1.1	1	1.1	Yes	Yes	1.1		Yes	Yes	Yes	Good	No flares needed		1
984	Owatonna	Yes	No	Yes	0.8	1	0.6	Yes	Yes	0.8	Yes	No			Poor	Dirt	Ponding?	0
985	Owatonna	Yes	No	Yes	1.8	1	0.4	Yes	Yes	1.8	Yes	No			Fair	Ponding	Ponding in front of aps and no flare on one side. Some veg	0
986	Owatonna	Yes	No	Yes	4.2	No	3.7	Yes	Yes	1.7	Yes	Yes	Yes	Yes	Fair	Some ponding and vegetation	Gap in elevation	0
987	Owatonna	Yes	No	Yes	2.3	No	2.2	Yes	Yes	1.5	Yes	No			Good			0
988	Owatonna	Yes	No	Yes	4.4	1	1.4	Yes	No	2.3	Yes	No			Fair	Some vegetation		0
989	Owatonna	Yes	No	Yes	1.4	No	3.1	Yes	Yes	2.0	Yes	No			Good			0
990	Owatonna	Yes	No	Yes	3.6	1	0.6	Yes	Yes	0.9	Yes	No			Fair	Ponding		0
991	Owatonna	Yes	No	Yes	1.5	1	0.7	Yes	Yes	1.5		Yes	Yes	Yes	Poor	No flares	Lots of rocks	0
992	Owatonna	Yes	No	Yes	0.5	1	0.6	Yes	Yes	0.6	Yes	Yes	Yes	Yes	Good		Some rocks	1
993	Owatonna	Yes	No	Yes	0.8	1	0.4	Yes	Yes	0.8	Yes	Yes	Yes	Yes	Fair	Ponding		1
994	Owatonna	Yes	No	Yes	0.4	1	0.5	Yes	Yes	0.5	Yes	Yes	Yes	Yes	Good		Some ponding/ sand	1
995	Owatonna	Yes	No	Yes	0.8	1	1.0	Yes	Yes	1.0	Yes	Yes	Yes	Yes	Good			1
996	Owatonna	Yes	No	Yes	0.2	1	0.0	Yes	Yes	0.0	Yes	Yes	Yes	Yes	Good			1
997	Owatonna	Yes	No	Yes	1.8	1	0.0	Yes	Yes	1.8		Yes	Yes	Yes	Good	No flares		1
998	Owatonna	Yes	No	Yes	0.1	1	0.5	Yes	Yes	0.5		Yes	Yes	Yes	Poor	No flares	Ponding/ lots of sand	0
999	Owatonna	Yes	No	Yes	1.7	1	0.4	Yes	Yes	1.7	Yes	Yes	Yes	Yes	Good			1
1000	Owatonna	Yes	Yes	Yes	0.8	No	3.5	Yes	Yes	1.2		N/A			Fair	No flares needed	Some veg	0
1001	Owatonna	Yes	Yes	Yes	0.1	No	3.2	Yes	Yes	1.3		N/A			Good	No flares needed		0
1002	Owatonna	Yes	Yes	Yes	0.3	1	1.0	Yes	Yes	1.0		N/A			Good	No flares needed		1
1003	Owatonna	Yes	Yes	Yes	0.6	1	0.6	Yes	Yes	0.6		N/A			Good	No flares needed		1
1004	Owatonna	Yes	No	Yes	0.3	1	0.7	Yes	Yes	0.7		No			Fair	No flares	Ponding	0
1005	Owatonna	Yes	No	Yes	3.8	1	0.2	Yes	Yes	0.9	Yes	Yes	Yes	Yes	Fair	Some ponding and vegetation	Gap	1
1006	Owatonna	Yes	No	Yes	5.0	No	3.2	Yes	No	5.0	No	No			Fair	Some vegetation		0
1007	Owatonna	Yes	No	Yes	2.5	1	1.5	Yes	No	2.6	Yes	No			Fair	Some ponding and vegetation		0
1008	Owatonna	Yes	No	Yes	0.8	1	0.0	Yes	Yes	0.8	Yes	Yes	Yes	Yes	Good			1
1009	Owatonna	Yes	No	Yes	5.2	1	0.7	Yes	Yes	0.6	Yes	Yes	Yes	Yes	Good			1
1010	Owatonna	Yes	No	Yes	0.7	1	0.2	Yes	Yes	0.7	Yes	Yes	Yes	Yes	Good			1
1011	Owatonna	Yes	No	Yes	0.1	1	0.8	Yes	Yes	0.8	Yes	Yes	Yes	Yes	Good			1
1012	Owatonna	Yes	No	Yes	4.3	1	0.2	Yes	Yes	0.7	Yes	Yes	Yes	Yes	Fair	Ponding		1
1013	Owatonna	Yes	No	Yes	2.3	1	0.8	Yes	Yes	0.7	Yes	Yes	Yes	Yes	Fair	Ponding		1
1014	Owatonna	Yes	No	Yes	0.6	1	0.7	Yes	Yes	0.7	Yes	Yes	Yes	Yes	Good			1
1015	Owatonna	Yes	No	Yes	0.6	1	0.6	Yes	Yes	0.6	Yes	Yes	Yes	Yes	Good			1
1016	Owatonna	Yes	No	Yes	1.9	1	1.0	Yes	Yes	1.9	Yes	Yes	Yes	Yes	Fair	Ponding		1
1017	Owatonna	Yes	No	Yes	1.0	1	0.6	Yes	Yes	1.0	Yes	Yes	Yes	Yes	Good			1
1018	Owatonna	Yes	No	Yes	1.7	1	1.4	Yes	Yes	1.7	Yes	Yes	Yes	Yes	Good			1
1019	Owatonna	Yes	No	Yes	1.9	1	0.9	Yes	Yes	1.9	Yes	Yes	Yes	Yes	Good			1
1020	Owatonna	Yes	No	Yes	4.0	1	0.7	Yes	Yes	0.5	Yes	Yes	Yes	Yes	Good			1
1021	Owatonna	Yes	No	Yes	1.3	1	0.9	Yes	Yes	1.3	Yes	Yes	Yes	Yes	Fair	Dirt		1
1022	Owatonna	Yes	No	Yes	0.7	1	1.2	Yes	Yes	1.2	Yes	Yes	Yes	Yes	Good			1
1023	Owatonna	Yes	No	Yes	0.9	1	1.1	Yes	Yes	1.1	Yes	Yes	Yes	Yes	Good			1
1024	Owatonna	Yes	No	Yes	3.8	No	2.6	Yes	Yes	1.6	Yes	No	Yes	Yes	Good		Man hole	0
1025	Owatonna	Yes	No	Yes	1.1	1	0.5	Yes	Yes	1.1	Yes	Yes	Yes	Yes	Fair	Some vegetation		1
1026	Owatonna	Yes	No	Yes	2.7	1	0.5	Yes	Yes	0.6	Yes	Yes	Yes	Yes	Fair	Some vegetation		1
1027	Owatonna	Yes	No	Yes	2.2	1	0.8	Yes	Yes	0.2	Yes	Yes	Yes	Yes	Good			1
1028	Owatonna	Yes	No	Yes	2.2	1	0.4	Yes	Yes	0.7	Yes	No	Yes	Yes	Good			0
1029	Owatonna	Yes	No	Yes	1.2	1	0.3	Yes	Yes	1.2	Yes	No	Yes	Yes	Fair	Some cracking		0
1030	Owatonna	Yes	Yes	Yes	2.4	No	2.8	Yes	No	2.4		N/A			Good	No flares needed		0
1031	Owatonna	Yes	Yes	Yes	2.0	No	4.5	Yes	Yes	1.4		N/A			Good	No flares needed		0
1032	Owatonna	Yes	Yes	Yes	2.4	No	3.5	Yes	Yes	1.1		N/A			Good	No flares needed		0
1033	Owatonna	Yes	Yes	Yes	1.2	No	2.9	Yes	Yes	1.6		N/A			Good	No flares needed		0

OBJECTID	City	If walk/trail crosses curb, is there a curb ramp?	Is the Curb Ramp at a Driveway	Running slope <= 8.3%?	What is the running slope of the curb ramp?	Cross slope, excluding flares, <= 2%?	What is the cross slope of the curb ramp?	Curb ramp, excluding flares, at least 48in wide?	Landing >= 48in sq with cross slope <2% any dir?	What is the max landing slope?	Curb ramp flares slopes <= 10%?	Detectable warnings full width of the curb ramp?	Approx 75% of truncated domes in good condition?	Truncated domes contrast w/ adjacent surfaces?	Curb Ramp overall condition?	CR_Characteristics	Notes	Compliant 1=Compliant
1034	Owatonna	Yes	Yes	Yes	3.6	1	1.3	Yes	Yes	0.4	Yes	Yes	Yes	Yes	Good		Man hole	1
1035	Owatonna	Yes	No	Yes	1.9	No	3.0	Yes	Yes	2.0	Yes	No	Yes	Yes	Good			0
1036	Owatonna	Yes	No	Yes	0.7	1	1.7	Yes	Yes	1.7	Yes	No	Yes	Yes	Fair	Some vegetation		0
1037	Owatonna	Yes	No	Yes	0.9	1	0.2	Yes	Yes	0.9	Yes	No	Yes	Yes	Good		One flare	0
1038	Owatonna	Yes	No	Yes	1.3	1	1.8	Yes	Yes	1.8	Yes	Yes	Yes	Yes	Good			1
1039	Owatonna	Yes	No	Yes	3.2	No	2.4	Yes	Yes	0.9	Yes	Yes	Yes	Yes	Good		Small man hole	0
1040	Owatonna	Yes	No	Yes	3.5	No	2.2	Yes	Yes	1.8	Yes	Yes	Yes	Yes	Good			0
1041	Owatonna	Yes	No	Yes	2.9	1	0.8	Yes	Yes	1.9	Yes	No	Yes	Yes	Good		Should be 2 curb ramps	0
1042	Owatonna	Yes	No	Yes	3.0	1	1.9	Yes	Yes	1.0	Yes	Yes	Yes	Yes	Good		Small man hole	1
1043	Owatonna	Yes	No	Yes	1.5	No	4.1	Yes	Yes	1.8	Yes	Yes	Yes	Yes	Good		Small man hole	0
1044	Owatonna	Yes	Yes	Yes	0.7	No	2.8	Yes	Yes	1.4		N/A			Good	No flares needed		0
1045	Owatonna	Yes	Yes	Yes	0.0	No	3.0	Yes	Yes	1.5		N/A			Good	No flares needed		0
1046	Owatonna	Yes	No	Yes	2.6	No	3.4	Yes	Yes	1.3	Yes	Yes	Yes	Yes	Fair	Some vegetation	Grate openings and gap by flare	0

TOTAL:	823
# Compliant:	214
% Compliant:	26%

OBJECTID	City	Is the route stable and slip-resistant?	Is the route at least 48in wide?	If >200ft x <60in, is there 60"x60" passing space?	If grates or openings, openings <= 0.5in?	Long dim of grate opening perpendicular to direction travel?	Running slope <= 5% or slope of parallel roadway?	What is the running slope?	Is the cross slope no steeper than 2%?	SW_Cross_slope	Are there no gaps in elevations or distances between concrete panels > 1.5?	Sidewalk overall condition	Are there any obstructions or ponding?	Does the sidewalk have any other characteristics?	Notes	Compliant 1=Compliant
2	Medford	Yes	Yes	N/A	N/A	N/A	Yes	0.7	Yes	1.8	Yes	Good				1
3	Medford	Yes	Yes	N/A	N/A	N/A	Yes	1.2	No	2.2	Yes	Good				0
4	Medford	Yes	Yes	N/A	N/A	N/A	Yes	0.8	Yes	1.0	Yes	Good				1
5	Medford	Yes	Yes	N/A	N/A	N/A	Yes	2.4	Yes	1.9	Yes	Good				1
6	Medford	Yes	Yes	N/A	N/A	N/A	Yes	1.9	Yes	0.5	Yes	Good				1
7	Medford	Yes	Yes	N/A	N/A	N/A	Yes	1.6	Yes	0.5	Yes	Good				1
8	Medford	Yes	Yes	N/A	N/A	N/A	Yes	0.3	Yes	0.7	No	Poor	Ponding	Some ponding and vegetation	Elevation gap getting on bridge	0
9	Medford	Yes	Yes	N/A	N/A	N/A	Yes	2.7	Yes	1.7	No	Good		Bridge		0
10	Medford	Yes	Yes	N/A	N/A	N/A	No	5.9	Yes	1.8	No	Poor	Ponding	Some ponding and vegetation	Bad elevation gap to bridge	0
11	Medford	Yes	Yes	N/A	N/A	N/A	Yes	3.0	No	2.9	Yes	Good				0
12	Medford	Yes	Yes	N/A	N/A	N/A	Yes	4.7	Yes	1.1	No	Good				0
13	Medford	Yes	Yes	N/A	N/A	N/A	Yes	1.2	Yes	1.8	Yes	Fair	Ponding	Bridge	Some ponding and vegetation on ends of bridge	1
14	Medford	Yes	Yes	N/A	N/A	N/A	Yes	0.2	No	2.7	Yes	Good				0
15	Medford	Yes	Yes	N/A	N/A	N/A	Yes	1.2	Yes	0.4	Yes	Good			Median	1
16	Medford	Yes	Yes	N/A	N/A	N/A	Yes	0.6	Yes	0.9	Yes	Fair		Some vegetation		1
17	Medford	Yes	Yes	N/A	N/A	N/A	Yes	2.7	Yes	1.7	Yes	Good				1
18	Medford	Yes	Yes	N/A	N/A	N/A	Yes	0.9	Yes	0.2	Yes	Fair		Heavy vegetation	Heavy vegetation in parts	1
19	Medford	Yes	Yes	N/A	N/A	N/A	Yes	2.7	Yes	0.0	Yes	Fair		Heavy vegetation		1
20	Medford	Yes	Yes	N/A	N/A	N/A	Yes	0.1	Yes	1.6	Yes	Good	Ponding	Ponding		1
21	Medford	Yes	Yes	N/A	N/A	N/A	Yes	0.8	Yes	1.8	Yes	Good				1
22	Medford	No	Yes	N/A	N/A	N/A	Yes	2.3	Yes	0.6	Yes	Poor		Heavy vegetation	Abandoned railroad tracks	0
23	Medford	Yes	Yes	N/A	N/A	N/A	Yes	0.8	No	6.6	Yes	Good				0
24	Medford	Yes	Yes	N/A	N/A	N/A	Yes	1.2	No	3.1	Yes	Good				0
25	Medford	Yes	Yes	N/A	N/A	N/A	Yes	0.2	Yes	1.3	Yes	Good	Obstruction	Low branches		1
26	Medford	Yes	Yes	N/A	N/A	N/A	Yes	1.7	No	3.4	No	Poor	Ponding	Some cracking and vegetation		0
27	Medford	Yes	Yes	N/A	N/A	N/A	Yes	4.5	Yes	0.4	Yes	Fair		Extensive cracking		1
28	Medford	Yes	Yes	N/A	N/A	N/A	Yes	0.7	Yes	0.9	Yes	Fair	Ponding	Ponding	One panel features ponding (depressed)	0
29	Medford	Yes	Yes	N/A	N/A	N/A	Yes	1.4	No	4.0	No	Good				0
30	Medford	Yes	Yes	N/A	N/A	N/A	Yes	1.0	No	2.7	Yes	Good				0
31	Medford	Yes	Yes	N/A	N/A	N/A	Yes	1.1	No	6.8	Yes	Good				0
32	Medford	Yes	Yes	N/A	N/A	N/A	No	6.8	No	2.2	Yes	Good		Some vegetation		0
33	Medford	Yes	Yes	N/A	N/A	N/A	Yes	4.1	No	2.2	Yes	Good				0
34	Medford	Yes	Yes	N/A	N/A	N/A	No	6.2	Yes	1.1	No	Good		Some vegetation		0
35	Medford	Yes	No	No	N/A	N/A	No	23.7	No	2.7	No	Fair		Some cracking and vegetation		0
36	Blooming Prairie	Yes	Yes	N/A	N/A	N/A	Yes	2.2	Yes	2.0	Yes	Good				1
37	Blooming Prairie	Yes	Yes	N/A	N/A	N/A	Yes	1.5	No	2.2	Yes	Fair		Extensive cracking	Driveway	0
38	Blooming Prairie	Yes	Yes	N/A	N/A	N/A	Yes	1.1	No	3.3	Yes	Good				0
39	Blooming Prairie	Yes	Yes	N/A	N/A	N/A	Yes	0.3	Yes	2.0	No	Fair				0
40	Blooming Prairie	Yes	Yes	N/A	N/A	N/A	Yes	0.8	Yes	0.5	Yes	Good				1
41	Blooming Prairie	Yes	Yes	N/A	N/A	N/A	Yes	1.1	Yes	1.1	Yes	Good		Some vegetation	Passing space	1
42	Blooming Prairie	Yes	No	Yes	N/A	N/A	Yes	0.3	Yes	0.3	Yes	Fair		Extensive cracking		0
43	Blooming Prairie	Yes	Yes	N/A	N/A	N/A	Yes	1.2	Yes	0.9	Yes	Good				1
44	Blooming Prairie	Yes	Yes	N/A	N/A	N/A	No	7.7	No	2.7	Yes	Poor		Some cracking and vegetation	Bad vegetation	0
45	Blooming Prairie	Yes	No	N/A	N/A	N/A	Yes	2.3	No	3.6	Yes	Fair		Heavy vegetation		0
46	Blooming Prairie	Yes	Yes	N/A	N/A	N/A	Yes	0.8	No	5.3	Yes	Good			Driveway	0
47	Blooming Prairie	Yes	No	N/A	N/A	N/A	Yes	0.8	No	3.7	Yes	Fair		Some vegetation		0
48	Blooming Prairie	Yes	Yes	N/A	N/A	N/A	Yes	0.6	No	5.1	No	Poor		Extensive cracking	Driveway	0
49	Blooming Prairie	Yes	Yes	N/A	N/A	N/A	Yes	0.2	Yes	1.6	No	Poor	Obstruction	Some vegetation		0
50	Blooming Prairie	Yes	No	N/A	N/A	N/A	Yes	0.5	No	7.3	Yes	Fair	Ponding	Ponding		0
51	Blooming Prairie	Yes	Yes	N/A	N/A	N/A	Yes	0.5	No	10.3	Yes	Good			Driveway	0
52	Blooming Prairie	Yes	Yes	N/A	N/A	N/A	Yes	0.2	No	7.6	Yes	Fair	Ponding	Ponding		0
53	Blooming Prairie	Yes	Yes	N/A	N/A	N/A	Yes	2.0	No	14.6	Yes	Good			Driveway	0
54	Blooming Prairie	Yes	Yes	N/A	N/A	N/A	Yes	0.3	No	3.3	Yes	Good				0
55	Blooming Prairie	Yes	Yes	N/A	N/A	N/A	Yes	0.7	No	13.3	Yes	Good			Driveway	0
56	Blooming Prairie	Yes	No	N/A	N/A	N/A	Yes	0.7	No	5.0	Yes	Good				0
57	Blooming Prairie	Yes	Yes	N/A	N/A	N/A	Yes	1.2	No	2.4	Yes	Good		Low branches		0
58	Blooming Prairie	Yes	Yes	N/A	N/A	N/A	Yes	0.9	No	2.4	Yes	Good		Some vegetation		0
59	Blooming Prairie	Yes	Yes	N/A	N/A	N/A	Yes	0.5	Yes	0.8	Yes	Good				1
60	Blooming Prairie	Yes	Yes	N/A	N/A	N/A	Yes	0.6	Yes	1.1	Yes	Good		Roots under pavement		1
61	Blooming Prairie	Yes	Yes	N/A	N/A	N/A	Yes	1.0	Yes	0.8	Yes	Good				1
62	Blooming Prairie	Yes	Yes	N/A	N/A	N/A	Yes	1.5	No	2.5	Yes	Good				0
63	Blooming Prairie	Yes	Yes	N/A	N/A	N/A	Yes	0.2	Yes	0.8	Yes	Good				1
64	Blooming Prairie	Yes	Yes	N/A	N/A	N/A	Yes	0.3	Yes	1.3	Yes	Good		Man hole		1
65	Blooming Prairie	Yes	Yes	N/A	N/A	N/A	Yes	0.1	Yes	1.8	No	Good		Some vegetation		0
66	Blooming Prairie	Yes	No	N/A	N/A	N/A	Yes	0.1	Yes	0.7	Yes	Good				0
67	Blooming Prairie	Yes	Yes	N/A	N/A	N/A	Yes	0.1	Yes	0.3	Yes	Good				1
68	Blooming Prairie	Yes	Yes	N/A	N/A	N/A	Yes	2.0	Yes	0.5	No	Poor	Obstruction		Train Tracks	0
69	Blooming Prairie	Yes	Yes	N/A	N/A	N/A	Yes	0.1	Yes	1.6	Yes	Good	Ponding	Excessive sand collected in walk	Excessive sand collected in walk	0
70	Blooming Prairie	Yes	Yes	N/A	N/A	N/A	Yes	3.3	No	2.7	Yes	Good				0

OBJECTID	City	Is the route stable and slip-resistant?	Is the route at least 48in wide?	If >200ft x <60in, is there 60"x60" passing space?	If grates or openings, openings <= 0.5in?	Long dim of grate opening perpendicular to direction travel?	Running slope <= 5% or slope of parallel roadway?	What is the running slope?	Is the cross slope no steeper than 2%?	SW_Cross_slope	Are there no gaps in elevations or distances between concrete panels > 1.5?	Sidewalk overall condition	Are there any obstructions or ponding?	Does the sidewalk have any other characteristics?	Notes	Compliant 1=Compliant
71	Blooming Prairie	Yes	Yes	N/A	N/A	N/A	Yes	0.5	Yes	0.7	Yes	Good				1
72	Blooming Prairie	Yes	Yes	N/A	N/A	N/A	Yes	1.5	Yes	0.9	Yes	Good				1
73	Blooming Prairie	Yes	Yes	N/A	N/A	N/A	Yes	0.7	Yes	0.8	Yes	Good				1
74	Blooming Prairie	Yes	Yes	N/A	N/A	N/A	Yes	0.2	Yes	0.9	Yes	Good				1
75	Blooming Prairie	Yes	Yes	N/A	N/A	N/A	Yes	0.0	Yes	1.0	Yes	Good				1
76	Blooming Prairie	Yes	Yes	N/A	N/A	N/A	Yes	0.0	Yes	1.0	Yes	Good				1
77	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.9	Yes	0.6	Yes	Good				1
78	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.9	Yes	0.6	Yes	Good		Ponding		1
79	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	4.3	Yes	0.4	Yes	Good				1
80	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.6	Yes	0.4	Yes	Good		Man hole		1
81	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	1.1	Yes	0.6	Yes	Good				1
82	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.8	Yes	1.1	Yes	Good				1
83	Owatonna	Yes	No	N/A	N/A	N/A	Yes	1.1	Yes	1.1	Yes	Good				0
84	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	1.3	Yes	0.9	Yes	Good				1
85	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	1.4	No	4.6	Yes	Fair		Man hole		0
86	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	1.0	Yes	1.4	Yes	Good				1
87	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.4	No	5.8	Yes	Good		Driveway		0
88	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.6	Yes	1.9	Yes	Good		Some vegetation		1
89	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.1	No	5.1	Yes	Good		Driveway		0
90	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.3	Yes	1.2	Yes	Good				1
91	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.0	Yes	1.4	Yes	Fair		Some vegetation		1
92	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.4	Yes	0.6	Yes	Good				1
93	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.0	No	3.9	Yes	Good		Driveway		0
94	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.5	Yes	0.7	Yes	Good				1
95	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.8	No	4.2	Yes	Good		Driveway		0
96	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.3	Yes	1.3	Yes	Good				1
97	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.4	No	5.3	Yes	Good		Driveway		0
98	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.2	Yes	1.7	Yes	Good				1
99	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.0	No	4.9	Yes	Good		Driveway		0
100	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.2	Yes	1.4	Yes	Fair		Man hole	Bad gap in elevation	1
101	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.8	No	4.1	Yes	Good		Driveway		0
102	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.1	Yes	1.4	Yes	Good				1
103	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.6	No	2.8	Yes	Good				0
104	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.6	No	4.4	Yes	Good		Driveway		0
105	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.1	No	3.7	Yes	Good				0
106	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.1	No	5.6	Yes	Good		Driveway		0
107	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.4	No	2.7	Yes	Good				0
108	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.8	No	6.0	Yes	Good		Driveway		0
109	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.6	No	2.5	Yes	Good				0
110	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.4	No	6.7	Yes	Good		Driveway		0
111	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.6	No	2.2	Yes	Good		Some vegetation		0
112	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.2	No	5.2	Yes	Fair	Ponding	Driveway		0
113	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.8	Yes	1.4	Yes	Good				1
114	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.1	No	5.6	Yes	Good		Driveway		0
115	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.7	No	3.9	Yes	Good				0
116	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.0	No	5.4	Yes	Good		Driveway		0
117	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.5	No	2.4	Yes	Good				0
118	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.3	No	3.8	Yes	Good		Driveway		0
119	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.3	Yes	0.9	Yes	Good	Ponding			1
120	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.6	No	4.4	Yes	Fair		Driveway	Cracking	0
121	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.1	Yes	1.9	Yes	Good				1
122	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.8	No	4.0	Yes	Good		Driveway		0
123	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.4	No	2.8	No	Good				0
124	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.3	No	4.5	Yes	Good		Driveway		0
125	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.0	No	2.1	Yes	Good				0
126	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.3	No	4.9	Yes	Good		Driveway		0
127	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.3	No	2.4	Yes	Good				0
128	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.2	No	5.2	Yes	Good		Driveway		0
129	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.5	No	2.8	Yes	Good		Man hole		0
130	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	1.1	No	4.7	Yes	Good		Driveway		0
131	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	1.3	Yes	1.0	Yes	Good				1
132	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.4	No	4.0	Yes	Good		Driveway		0
133	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.1	Yes	0.4	Yes	Good				1
134	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.1	No	2.8	Yes	Good		Driveway		0
135	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.0	Yes	0.6	No	Good				0
136	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.8	No	3.4	Yes	Good		Driveway		0
137	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	1.0	No	3.3	Yes	Good		Driveway		0
138	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	1.0	No	4.2	Yes	Good		Driveway		0
139	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	1.0	No	5.0	Yes	Good		Driveway		0

OBJECTID	City	Is the route stable and slip-resistant?	Is the route at least 48in wide?	If >200ft x <60in, is there 60"x60" passing space?	If grates or openings, openings <= 0.5in?	Long dim of grate opening perpendicular to direction travel?	Running slope <= 5% or slope of parallel roadway?	What is the running slope?	Is the cross slope no steeper than 2%?	SW_Cross_slope	Are there no gaps in elevations or distances between concrete panels > 1.5?	Sidewalk overall condition	Are there any obstructions or ponding?	Does the sidewalk have any other characteristics?	Notes	Compliant 1=Compliant
170	Ellendale	Yes	Yes	N/A	N/A	N/A	Yes	3.3	No	4.8	Yes	Good		Driveway		0
171	Ellendale	Yes	Yes	N/A	N/A	N/A	Yes	5.2	No	2.4	Yes	Fair	Ponding	Some vegetation		0
172	Ellendale	Yes	Yes	N/A	N/A	N/A	Yes	1.0	Yes	1.2	Yes	Fair	Ponding	Some vegetation		1
173	Hope	Yes	Yes	N/A	N/A	N/A	Yes	0.2	Yes	0.4	Yes	Good		Some vegetation		1
174	Hope	Yes	Yes	N/A	N/A	N/A	Yes	0.3	No	3.2	Yes	Good		Driveway		0
175	Hope	Yes	Yes	N/A	N/A	N/A	Yes	0.3	No	2.4	Yes	Good		Some vegetation		0
176	Hope	Yes	Yes	N/A	N/A	N/A	Yes	0.2	No	2.5	Yes	Good		Driveway		0
177	Hope	Yes	Yes	N/A	N/A	N/A	Yes	0.6	Yes	0.8	Yes	Good	Obstruction			1
178	Hope	Yes	Yes	N/A	N/A	N/A	Yes	0.3	No	2.4	Yes	Good		Man hole		0
179	Hope	Yes	Yes	N/A	N/A	N/A	Yes	0.4	Yes	1.0	Yes	Good		Driveway		1
180	Hope	Yes	Yes	N/A	N/A	N/A	Yes	0.3	Yes	1.4	Yes	Good		Some vegetation		1
181	Hope	Yes	Yes	N/A	N/A	N/A	Yes	0.4	No	3.5	Yes	Good		Driveway		0
182	Hope	Yes	Yes	N/A	N/A	N/A	Yes	0.7	Yes	1.9	Yes	Good		Some vegetation		1
183	Hope	Yes	Yes	N/A	N/A	N/A	Yes	0.5	No	3.2	Yes	Good		Driveway		0
184	Hope	Yes	Yes	N/A	N/A	N/A	Yes	0.2	No	2.5	No	Good				0
185	Blooming Prairie	Yes	Yes	N/A	N/A	N/A	Yes	1.0	Yes	0.4	Yes	Good				1
186	Blooming Prairie	Yes	Yes	N/A	N/A	N/A	Yes	0.6	No	2.1	Yes	Good				0
187	Blooming Prairie	Yes	Yes	N/A	N/A	N/A	Yes	1.0	Yes	0.1	Yes	Good				1
188	Blooming Prairie	Yes	Yes	N/A	N/A	N/A	Yes	0.3	Yes	1.2	Yes	Good				1
189	Blooming Prairie	Yes	Yes	N/A	N/A	N/A	Yes	0.7	Yes	1.0	Yes	Poor		Pavement damage	Driveway	0
190	Blooming Prairie	Yes	Yes	N/A	N/A	N/A	Yes	0.2	Yes	0.5	Yes	Good				1
191	Blooming Prairie	Yes	Yes	N/A	N/A	N/A	Yes	0.3	Yes	0.7	Yes	Good				1
192	Blooming Prairie	Yes	Yes	N/A	N/A	N/A	Yes	0.4	Yes	1.3	Yes	Poor		Pavement damage	Driveway	0
193	Blooming Prairie	Yes	Yes	N/A	N/A	N/A	Yes	0.2	Yes	1.0	Yes	Fair	Obstruction	Some vegetation	Big garbage dumpster blocking path	1
194	Blooming Prairie	Yes	Yes	N/A	N/A	N/A	Yes	3.2	No	2.7	No	Fair				0
195	Blooming Prairie	Yes	No	N/A	N/A	N/A	Yes	0.0	Yes	2.0	No	Poor		Man hole		0
196	Blooming Prairie	Yes	Yes	N/A	N/A	N/A	Yes	0.1	Yes	1.1	Yes	Fair		Man hole	Some vegetation	1
197	Blooming Prairie	Yes	Yes	N/A	N/A	N/A	Yes	0.8	No	3.0	Yes	Good				0
198	Blooming Prairie	Yes	Yes	N/A	N/A	N/A	Yes	0.6	No	3.0	No	Fair		Extensive cracking	Driveway	0
199	Blooming Prairie	Yes	No	N/A	N/A	N/A	Yes	2.9	No	3.0	No	Fair		Some vegetation	Bad elevation gap	0
200	Blooming Prairie	Yes	No	N/A	N/A	N/A	Yes	2.8	No	4.0	No	Poor		Roots under pavement		0
201	Blooming Prairie	Yes	Yes	N/A	N/A	N/A	Yes	0.2	No	5.0	Yes	Good		Driveway		0
202	Blooming Prairie	Yes	Yes	N/A	N/A	N/A	Yes	1.3	Yes	0.8	Yes	Good				1
228	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.5	Yes	1.8	Yes	Good				1
229	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.6	No	2.9	Yes	Good		Driveway		0
230	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	1.8	Yes	1.6	Yes	Good				1
231	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	1.0	No	3.0	Yes	Fair	Ponding			0
232	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.6	No	4.9	Yes	Good		Driveway		0
271	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	1.2	Yes	1.2	Yes	Good				1
272	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	1.7	Yes	1.6	Yes	Good				1
273	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.2	Yes	0.9	Yes	Good				1
288	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.1	Yes	1.2	Yes	Good				1
289	Owatonna	Yes	Yes	N/A	N/A	N/A	No	9.3	Yes	0.2	Yes	Good			Random Steep slope	0
290	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	2.3	Yes	1.0	Yes	Fair		Some vegetation	Manhole	1
291	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.3	Yes	0.6	Yes	Fair	Ponding	Heavy vegetation	Panel dropped, sand accumulation	0
292	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.3	Yes	0.0	Yes	Poor			Dirt and rocks	0
293	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.5	Yes	1.4	Yes	Fair	Ponding	Heavy sand accumulation	Heavy sand accumulation	0
294	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.2	No	4.2	Yes	Good		Man hole		0
295	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.9	No	6.1	Yes	Good		Driveway		0
296	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.3	No	3.3	Yes	Good				0
297	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.1	No	4.1	No	Fair		Driveway	Cracking	0
298	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	1.6	Yes	1.6	Yes	Good				1
299	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.9	Yes	1.5	Yes	Good				1
300	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	1.1	Yes	1.7	Yes	Good				1
301	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.7	Yes	1.5	Yes	Good				1
302	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.4	No	2.2	Yes	Good				0
303	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.0	No	2.5	Yes	Good		Some cracking		0
304	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.2	No	3.9	Yes	Good		Driveway		0
305	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.0	Yes	1.3	Yes	Fair	Ponding	Heavy sand accumulation	Heavy sand accumulation	0
307	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.2	Yes	1.6	Yes	Good				1
308	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	3.4	No	3.1	Yes	Good				0
309	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.6	No	2.3	Yes	Good		Driveway		0
310	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.3	Yes	1.9	Yes	Good				1
311	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.4	Yes	0.5	Yes	Good		Some vegetation		1
312	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.2	Yes	1.3	Yes	Good				1
313	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.9	Yes	0.3	Yes	Good				1
314	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.8	Yes	1.3	Yes	Good				1
315	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.8	No	2.8	Yes	Good				0
316	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.3	Yes	0.4	Yes	Fair	Ponding			1

OBJECTID	City	Is the route stable and slip-resistant?	Is the route at least 48in wide?	If >200ft x <60in, is there 60"x60" passing space?	If grates or openings, openings <= 0.5in?	Long dim of grate opening perpendicular to direction travel?	Running slope <= 5% or slope of parallel roadway?	What is the running slope?	Is the cross slope no steeper than 2%?	SW_Cross_slope	Are there no gaps in elevations or distances between concrete panels > 1.5?	Sidewalk overall condition	Are there any obstructions or ponding?	Does the sidewalk have any other characteristics?	Notes	Compliant 1=Compliant
322	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.4	Yes	0.5	Yes	Good	Obstruction			1
329	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.6	No	4.4	Yes	Good		Driveway		0
330	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.1	Yes	1.2	Yes	Good			Man hole	1
331	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.3	Yes	1.7	Yes	Good				1
332	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.3	No	3.5	Yes	Good		Driveway		0
333	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.3	Yes	1.8	Yes	Fair	Ponding	Heavy sand accumulation	Heavy sand accumulation	0
343	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	2.7	No	3.5	Yes	Good		Roots under pavement		0
353	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.6	No	4.3	Yes	Good		Driveway		0
354	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.2	Yes	0.8	Yes	Good	Obstruction	Electrical pole obstruction		0
355	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.6	Yes	1.4	Yes	Good			Obstruction but wide enough	1
356	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.0	No	4.0	Yes	Good		Driveway		0
357	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.2	Yes	0.9	Yes	Good				1
358	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.5	No	4.6	Yes	Good		Driveway		0
359	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.4	No	2.4	Yes	Good			Electrical poles but wide enough (and fire hydrant)	0
360	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	1.3	Yes	0.6	Yes	Good			Electrical pole but wide enough	1
361	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.4	No	3.4	Yes	Good		Driveway		0
362	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.0	Yes	0.8	Yes	Fair	Ponding	Heavy sand accumulation	Heavy sand accumulation	0
363	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.9	No	4.5	Yes	Good		Driveway		0
364	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.7	Yes	0.6	No	Good			Electrical pole but wide enough	0
365	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.5	No	3.9	Yes	Good		Driveway		0
366	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.6	Yes	0.9	Yes	Good			Electrical pole but wide enough	1
367	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.0	No	4.0	Yes	Good		Driveway		0
368	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.9	Yes	1.9	Yes	Good				1
369	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.3	No	4.3	Yes	Good		Driveway		0
370	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.9	Yes	0.8	Yes	Good			Electrical pole but wide enough	1
371	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	1.1	No	3.4	Yes	Good		Driveway		0
372	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	1.4	Yes	1.0	Yes	Good	Obstruction	Fire hydrant obstruction	Fire hydrant obstruction	0
373	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	1.3	No	4.3	Yes	Good		Driveway		0
374	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	1.1	Yes	0.9	Yes	Good			Electrical pole but wide enough	1
375	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	1.5	No	4.0	Yes	Good		Driveway		0
376	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	1.3	Yes	1.0	Yes	Good			Electrical pole but wide enough	1
377	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	1.6	No	2.3	Yes	Good			Electrical pole but wide enough	0
378	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	1.2	No	2.9	Yes	Good		Driveway		0
379	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	1.6	Yes	2.0	Yes	Good			Electrical pole but wide enough	1
380	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.2	No	4.0	Yes	Good		Driveway		0
381	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	1.7	Yes	2.0	Yes	Good				1
382	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.3	No	4.9	Yes	Good		Driveway		0
383	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.0	No	2.7	Yes	Fair	Ponding		Electrical pole but wide enough	0
384	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.7	No	6.0	Yes	Good		Driveway		0
385	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	1.2	No	2.9	Yes	Good	Obstruction		Fire hydrant obstruction	0
386	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.2	No	2.4	Yes	Good				0
387	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.3	No	5.0	Yes	Good		Driveway		0
388	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.6	Yes	1.2	Yes	Fair	Ponding	Some cracking		1
389	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.4	No	4.0	Yes	Good		Driveway		0
390	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.6	Yes	1.5	Yes	Good				1
391	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.3	No	3.7	Yes	Good		Driveway		0
392	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	1.3	Yes	1.0	Yes	Good				1
393	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.8	No	3.3	Yes	Good		Driveway		0
394	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	1.3	Yes	0.8	Yes	Good				1
395	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	1.7	No	3.9	Yes	Good		Driveway		0
396	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	1.7	Yes	0.5	Yes	Good				1
397	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	1.3	No	2.7	Yes	Good		Driveway		0
398	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	1.5	Yes	0.9	Yes	Good				1
399	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	1.7	No	3.6	Yes	Good		Driveway		0
400	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	4.5	Yes	0.1	Yes	Good				1
401	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	2.0	Yes	0.8	Yes	Good				1
402	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	1.3	No	4.5	Yes	Good		Driveway		0
403	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	1.6	Yes	0.7	Yes	Good				1
404	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	2.0	No	3.7	Yes	Good		Driveway		0
405	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	1.3	Yes	0.6	Yes	Good				1
406	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	1.0	No	2.9	Yes	Good		Driveway		0
407	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	1.2	Yes	0.3	Yes	Good				1
408	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.4	No	3.1	Yes	Good		Driveway		0
409	Owatonna	Yes	No	N/A	N/A	N/A	Yes	0.7	Yes	0.9	Yes	Good	Obstruction		Pole but grass goes on sidewalk making it less than 48 inch	0
410	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.8	No	2.9	Yes	Good		Driveway		0
411	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.5	Yes	1.0	Yes	Fair	Ponding			1
412	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.5	No	3.4	Yes	Good		Driveway		0

OBJECTID	City	Is the route stable and slip-resistant?	Is the route at least 48in wide?	If >200ft x <60in, is there 60"x60" passing space?	If grates or openings, openings <= 0.5in?	Long dim of grate opening perpendicular to direction travel?	Running slope <= 5% or slope of parallel roadway?	What is the running slope?	Is the cross slope no steeper than 2%?	SW_Cross_slope	Are there no gaps in elevations or distances between concrete panels > 1.5?	Sidewalk overall condition	Are there any obstructions or ponding?	Does the sidewalk have any other characteristics?	Notes	Compliant 1=Compliant
413	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.8	Yes	0.6	Yes	Good				1
414	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.8	No	3.7	Yes	Good		Driveway		0
415	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.3	Yes	1.3	Yes	Good				1
416	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.3	No	3.8	Yes	Good		Driveway		0
417	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.2	Yes	0.6	Yes	Good				1
418	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.7	No	2.6	Yes	Good		Driveway		0
419	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	1.0	Yes	1.5	Yes	Good				1
420	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.3	No	3.4	Yes	Good		Driveway		0
421	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.4	Yes	0.8	Yes	Good				1
422	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.7	Yes	0.7	Yes	Good				1
423	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.3	No	2.5	Yes	Good		Driveway		0
424	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.2	Yes	1.8	Yes	Good				1
425	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.2	No	4.5	Yes	Good		Driveway		0
426	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	1.7	Yes	1.6	Yes	Fair	Ponding	Heavy sand accumulation	Heavy sand accumulation	0
427	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.2	No	3.4	Yes	Good		Driveway		0
428	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.8	Yes	1.1	Yes	Fair		Some vegetation		1
429	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.6	Yes	1.0	Yes	Good				1
430	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	1.0	No	4.0	Yes	Good		Driveway		0
431	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	1.4	Yes	0.8	Yes	Fair	Ponding			1
432	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.3	No	2.8	Yes	Good		Driveway		0
433	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.9	Yes	1.2	Yes	Good				1
434	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	1.0	No	3.2	Yes	Good				0
475	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.2	No	2.9	Yes	Good				0
476	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.9	Yes	0.6	Yes	Good		Man hole		1
477	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.3	Yes	1.1	Yes	Fair		Some cracking		1
478	Owatonna	Yes	Yes	N/A	No	N/A	Yes	4.5	Yes	1.4	Yes	Good				0
479	Owatonna	Yes	Yes	N/A	N/A	N/A	No	5.8	Yes	1.0	Yes	Good			Wide driving	0
480	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.7	Yes	0.7	Yes	Fair		Some cracking and vegetation		1
481	Owatonna	Yes	Yes	N/A	No	No	Yes	1.1	Yes	0.1	No	Good			Train track	0
482	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.7	Yes	0.1	No	Fair		Man hole		0
483	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	3.4	Yes	0.4	Yes	Good		Man hole		1
484	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	4.0	No	3.5	Yes	Good		Driveway	Crack	0
485	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	3.8	No	2.3	Yes	Good				0
486	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	3.1	No	5.1	Yes	Good		Driveway		0
487	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	3.4	No	3.1	No	Good				0
488	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	3.6	No	5.2	Yes	Good		Driveway		0
489	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	3.6	No	3.0	Yes	Good		Some vegetation		0
490	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	2.6	No	4.8	Yes	Good		Driveway	Crack	0
491	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	3.3	No	2.3	Yes	Fair		Some vegetation		0
492	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	1.6	Yes	1.8	No	Poor		Man hole	Square gap	0
493	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	1.4	No	5.1	Yes	Good		Driveway		0
494	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	1.8	Yes	1.2	Yes	Good				1
495	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.4	No	5.2	Yes	Good		Driveway		0
496	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.0	Yes	0.7	Yes	Good				1
497	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.8	No	4.7	Yes	Good		Driveway		0
498	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.4	Yes	1.7	Yes	Good				1
499	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.1	No	4.1	Yes	Good		Driveway		0
500	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.6	Yes	1.6	Yes	Good		Some vegetation		1
501	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.3	Yes	1.6	Yes	Good		Man hole		1
502	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.0	No	4.3	Yes	Good		Driveway		0
503	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	1.1	No	2.1	Yes	Good				0
504	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.3	No	3.9	Yes	Fair		Driveway	Rocks	0
505	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.4	No	2.8	Yes	Good				0
506	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	1.5	No	5.5	Yes	Good		Driveway		0
507	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	2.1	No	2.1	Yes	Good				0
508	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	1.5	No	5.7	Yes	Good		Driveway		0
509	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	2.1	Yes	1.6	Yes	Good				1
510	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	2.3	No	6.1	Yes	Good		Driveway		0
511	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	3.0	No	3.4	Yes	Good				0
512	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	3.0	No	5.3	Yes	Good		Driveway		0
513	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	2.2	No	2.8	Yes	Good				0
514	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	3.3	No	6.3	Yes	Good		Driveway		0
515	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	3.5	No	3.5	Yes	Good				0
516	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	3.2	No	5.9	Yes	Good		Driveway		0
517	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	3.4	No	2.4	Yes	Good				0
518	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	3.8	Yes	1.8	Yes	Good				1
519	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	3.6	No	3.1	Yes	Good		Driveway		0
520	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	3.7	Yes	1.3	Yes	Good		Man hole		1
521	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.7	No	4.0	No	Fair	Ponding	Man hole		0

OBJECTID	City	Is the route stable and slip-resistant?	Is the route at least 48in wide?	If >200ft x <60in, is there 60"x60" passing space?	If grates or openings, openings <= 0.5in?	Long dim of grate opening perpendicular to direction travel?	Running slope <= 5% or slope of parallel roadway?	What is the running slope?	Is the cross slope no steeper than 2%?	SW_Cross_slope	Are there no gaps in elevations or distances between concrete panels > 1.5?	Sidewalk overall condition	Are there any obstructions or ponding?	Does the sidewalk have any other characteristics?	Notes	Compliant 1=Compliant
522	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	1.1	No	5.4	Yes	Good		Driveway		0
523	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	2.3	Yes	1.7	Yes	Good				1
524	Owatonna	Yes	Yes	N/A	No	No	Yes	0.4	Yes	0.0	No	Good		Driveway	Train track	0
525	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	1.1	Yes	1.1	Yes	Good				1
526	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.8	No	2.9	Yes	Good		Driveway		0
527	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.4	Yes	0.4	Yes	Good				1
528	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	1.3	Yes	1.7	Yes	Good				1
529	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.0	Yes	0.5	Yes	Good				1
530	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	1.2	Yes	2.0	No	Fair	Obstruction	Some cracking	Man hole , bush	0
531	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	4.7	No	3.9	Yes	Good		Driveway		0
532	Owatonna	Yes	No	N/A	N/A	N/A	No	6.2	No	3.6	Yes	Fair		Some vegetation		0
533	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	4.5	No	6.9	Yes	Good		Driveway		0
534	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.3	No	2.5	Yes	Good				0
548	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.7	Yes	0.2	Yes	Good				1
549	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.2	Yes	0.3	Yes	Good				1
550	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.6	Yes	1.7	Yes	Good				1
551	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	1.4	No	4.3	Yes	Good		Driveway		0
552	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	2.2	No	2.1	Yes	Good				0
553	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	1.9	No	4.5	Yes	Good		Driveway		0
554	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	3.1	Yes	1.7	Yes	Good		Some cracking		1
555	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	2.5	No	3.5	Yes	Good		Driveway		0
556	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	4.3	Yes	1.4	Yes	Good		Some cracking	Electrical pole but wide enough	1
557	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	3.2	No	3.5	Yes	Good		Driveway		0
558	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	3.4	Yes	1.0	Yes	Fair		Some cracking		1
559	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	3.3	No	3.3	Yes	Good		Driveway		0
560	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	3.6	Yes	0.1	Yes	Good				1
561	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	3.6	No	2.3	Yes	Good		Driveway		0
562	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	2.9	Yes	0.4	No	Fair		Some vegetation		0
563	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	2.7	No	3.1	Yes	Good		Driveway		0
564	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	3.3	Yes	0.9	Yes	Fair		Some cracking and vegetation		1
565	Owatonna	Yes	Yes	N/A	N/A	N/A	No	5.4	No	3.0	Yes	Good		Driveway		0
566	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	4.2	No	2.8	Yes	Good		Driveway		0
567	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	4.8	Yes	0.3	Yes	Good				1
568	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	4.2	Yes	0.1	Yes	Fair		Some cracking		1
569	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	3.6	No	2.5	Yes	Good		Driveway		0
570	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	2.9	Yes	1.2	Yes	Good				1
571	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	2.8	No	2.5	Yes	Good		Driveway		0
572	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	1.6	Yes	0.6	Yes	Good				1
573	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	1.0	No	4.3	Yes	Good		Driveway		0
574	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	1.6	Yes	1.7	Yes	Good				1
575	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.5	No	3.1	Yes	Good		Driveway		0
576	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.3	Yes	1.0	Yes	Good				1
577	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.8	No	2.7	Yes	Good		Driveway		0
578	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.1	Yes	1.2	Yes	Fair	Ponding	Some vegetation		1
579	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.4	Yes	1.9	Yes	Good				1
580	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.7	No	3.4	Yes	Good		Driveway		0
581	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	1.1	Yes	1.0	Yes	Good				1
582	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.4	No	3.4	Yes	Good		Driveway		0
583	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	1.7	Yes	1.8	Yes	Good				1
584	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	1.0	No	3.4	Yes	Good		Driveway		0
585	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.6	Yes	1.7	Yes	Good				1
586	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	1.8	No	3.7	Yes	Good		Driveway		0
587	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.9	Yes	1.0	Yes	Good				1
588	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.9	No	2.3	Yes	Good		Driveway		0
589	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.7	Yes	1.4	Yes	Good				1
590	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	1.1	No	3.6	Yes	Good	Obstruction			0
591	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.2	No	4.2	Yes	Good		Driveway		0
592	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.6	Yes	1.4	Yes	Fair		Man hole		1
593	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.1	No	3.8	Yes	Good		Driveway		0
594	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.5	Yes	1.1	Yes	Good				1
595	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.4	Yes	1.3	Yes	Good				1
596	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.4	No	3.8	Yes	Good		Driveway		0
597	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.2	Yes	1.0	Yes	Good				1
598	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.4	No	2.8	Yes	Good		Driveway		0
599	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	1.3	No	2.2	Yes	Good				0
600	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	1.1	Yes	1.0	Yes	Good			Electrical pole but wide enough	1
601	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.5	No	3.8	Yes	Good		Driveway		0
602	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	1.0	Yes	0.8	Yes	Good				1
603	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.4	Yes	1.3	Yes	Good		Driveway		1

OBJECTID	City	Is the route stable and slip-resistant?	Is the route at least 48in wide?	If >200ft x <60in, is there 60"x60" passing space?	If grates or openings, openings <= 0.5in?	Long dim of grate opening perpendicular to direction travel?	Running slope <= 5% or slope of parallel roadway?	What is the running slope?	Is the cross slope no steeper than 2%?	SW_Cross_slope	Are there no gaps in elevations or distances between concrete panels > 1.5?	Sidewalk overall condition	Are there any obstructions or ponding?	Does the sidewalk have any other characteristics?	Notes	Compliant 1=Compliant
604	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.4	Yes	1.5	Yes	Good			Electrical pole and fire hydrant but wide enough	1
605	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.8	No	2.2	No	Good			Electrical pole but wide enough	0
606	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.5	Yes	1.1	Yes	Good			Driveway	1
607	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.3	No	2.4	No	Fair		Some vegetation	Electrical pole but wide enough	0
608	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.0	No	4.5	Yes	Good			Driveway	0
609	Owatonna	Yes	No	N/A	N/A	N/A	Yes	0.2	Yes	1.6	Yes	Good		Some vegetation	Where electrical pole is it's not wide enough, fire hydrant not wife enough	0
610	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.8	Yes	0.8	Yes	Good		Some vegetation		1
611	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	1.1	No	3.7		Good		Driveway		0
612	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	1.3	No	2.6	Yes	Good				0
613	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	2.0	No	4.2	Yes	Good		Driveway		0
614	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	1.8	Yes	1.3	Yes	Good			Electrical pole but wide enough	1
615	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	1.3	No	4.1	Yes	Good		Driveway		0
616	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	1.6	Yes	1.3	Yes	Good		Some vegetation		1
617	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	1.7	No	2.5	Yes	Good		Driveway		0
618	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	2.1	Yes	0.9	Yes	Good		Some vegetation	Electrical pole but wide enough	1
619	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.2	No	4.1	Yes	Good		Driveway	Crack	0
620	Owatonna	Yes	Yes	N/A	N/A	N/A	No	5.9	Yes	1.5	No	Fair	Ponding		Electrical pole but wide enough	0
621	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	3.8	No	4.1	Yes	Good		Driveway		0
622	Owatonna	Yes	Yes	Yes	N/A	N/A	Yes	3.2	No	2.4	No	Good	Obstruction		Electrical pole but wide enough, fire hydrant not wide enough	0
623	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	2.0	No	2.6	Yes	Good		Driveway		0
624	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	3.8	Yes	1.0	No	Fair		Some cracking and vegetation	Electrical pole but wide enough	0
625	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	2.5	Yes	1.3	No	Fair		Some cracking and vegetation	Electrical pole but wide enough	0
626	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	3.2	No	3.1	Yes	Good		Driveway		0
627	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	3.0	Yes	1.5	Yes	Good			Electrical pole but wide enough	1
628	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	2.4	No	4.0	Yes	Good		Driveway		0
629	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	3.8	Yes	0.8	Yes	Good				1
630	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	3.6	No	3.1	Yes	Good		Driveway		0
631	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	2.5	Yes	0.2	No	Good			Electrical pole but wide enough	0
632	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.6	Yes	0.2	Yes	Good				1
633	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.3	Yes	0.1	Yes	Good				1
634	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.1	Yes	1.1	Yes	Good				1
635	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.0	Yes	1.1	Yes	Good				1
636	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.4	Yes	2.0	Yes	Good		Man hole		1
637	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	3.4	Yes	0.9	Yes	Good				1
638	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	4.1	No	2.1	Yes	Good			Crack	0
639	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.3	Yes	0.3	Yes	Good				1
640	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.0	No	2.7	Yes	Fair	Ponding	Some cracking and vegetation		0
641	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	2.2	Yes	0.9	No	Fair	Ponding	Some vegetation		0
642	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.7	Yes	1.8	Yes	Good	Ponding	Heavy sand accumulation	Heavy sand accumulation	0
643	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	4.1	Yes	0.1	Yes	Fair		Some ponding and vegetation		1
644	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.0	Yes	1.1	Yes	Good				1
645	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.6	Yes	0.8	Yes	Good				1
646	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.5	Yes	1.2	Yes	Good				1
647	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.7	Yes	1.0	Yes	Good				1
648	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.4	Yes	1.1	Yes	Good				1
649	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.5	Yes	0.6	Yes	Good				1
650	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.1	Yes	1.1	Yes	Good			Crack/ pothole	1
651	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.3	Yes	0.8	No	Good	Ponding			0
652	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.5	Yes	0.9	Yes	Good				1
653	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	3.8	Yes	1.3	No	Poor	Ponding	Displaced slab	Some veg	0
654	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	3.2	Yes	0.9	Yes	Good	Ponding	Heavy sand accumulation	Heavy sand accumulation	0
655	Owatonna	Yes	Yes	N/A	N/A	N/A	No	5.7	Yes	1.5	Yes	Good				0
656	Owatonna	Yes	Yes	N/A	No	N/A	Yes	4.9	No	2.1	Yes	Good			Hexagon pavements	0
657	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.2	Yes	1.5	No	Fair	Ponding	Some cracking		0
658	Owatonna	Yes	Yes	N/A	No	No	Yes	3.3	Yes	1.4	No	Poor	Ponding	Man hole		0
659	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.8	No	2.1	No	Fair				0
660	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.1	No	3.2	Yes	Fair	Ponding	Driveway	Some cracking	0
661	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.8	No	2.9	Yes	Fair		Some cracking		0
662	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.9	No	5.3	Yes	Good		Driveway		0
663	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.1	No	4.5	Yes	Good				0
664	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.4	No	6.1	Yes	Good		Driveway		0
665	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.3	No	2.3	Yes	Fair		Some cracking	Man hole	0
666	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.8	Yes	0.5	Yes	Fair	Ponding			1
667	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.8	Yes	1.7	Yes	Fair		Driveway	Crack	1
668	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	1.0	No	2.6	Yes	Fair		Some cracking	Man hole	0
669	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.3	Yes	1.2	Yes	Good				1
670	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	1.7	No	5.0	No	Fair				0

OBJECTID	City	Is the route stable and slip-resistant?	Is the route at least 48in wide?	If >200ft x <60in, is there 60"x60" passing space?	If grates or openings, openings <= 0.5in?	Long dim of grate opening perpendicular to direction travel?	Running slope <= 5% or slope of parallel roadway?	What is the running slope?	Is the cross slope no steeper than 2%?	SW_Cross_slope	Are there no gaps in elevations or distances between concrete panels > 1.5?	Sidewalk overall condition	Are there any obstructions or ponding?	Does the sidewalk have any other characteristics?	Notes	Compliant 1=Compliant
671	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.0	Yes	1.4	No	Fair	Ponding		Cars in sidewalk	0
672	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.2	No	4.0	Yes	Good		Man hole		0
673	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.2	Yes	1.8	Yes	Good		Driveway		1
674	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.1	Yes	1.9	Yes	Good				1
675	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.4	Yes	1.5	Yes	Good				1
676	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.3	No	3.2	No	Fair	Ponding	Driveway		0
677	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.6	No	3.1	Yes	Fair	Ponding			0
678	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	2.5	No	2.5	No	Good				0
679	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	2.2	No	5.9	Yes	Good		Man hole		0
680	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.1	Yes	1.4	No	Fair		Some cracking		0
681	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	2.5	No	3.6	Yes	Good		Driveway		0
682	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	2.9	Yes	1.9	Yes	Good				1
683	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.5	Yes	1.5	Yes	Good				1
684	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	1.3	No	2.3	Yes	Good		Driveway		0
685	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	1.0	No	3.0	Yes	Good				0
686	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.9	Yes	0.9	Yes	Good		Some cracking		1
687	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.6	No	2.4	Yes	Good		Driveway		0
688	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.0	Yes	1.2	Yes	Good				1
689	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	2.3	Yes	0.4	Yes	Good				1
690	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	3.4	Yes	0.4	Yes	Good				1
691	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.9	Yes	0.4	Yes	Good				1
692	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	2.3	Yes	0.7	Yes	Good				1
693	Owatonna	Yes	Yes	N/A	No	No	Yes	0.1	Yes	0.3	No	Good			Train track	0
694	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.3	No	2.6	Yes	Fair	Ponding			0
695	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	4.1	Yes	1.7	Yes	Good			Some dirt	1
696	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	2.9	No	3.3	Yes	Good				0
697	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	3.5	No	4.2	Yes	Good				0
698	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	4.6	Yes	0.6	Yes	Good				1
699	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.1	No	3.3	Yes	Good		Driveway		0
700	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	2.5	No	2.4	Yes	Fair		Some vegetation		0
701	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	1.5	No	6.1	Yes	Good		Driveway		0
702	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	2.0	Yes	1.4	Yes	Good				1
703	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.3	No	6.6	Yes	Good		Driveway		0
704	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	1.1	Yes	1.3	Yes	Good				1
705	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.5	No	4.2	Yes	Good		Driveway		0
706	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.5	Yes	1.6	Yes	Good				1
707	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	1.9	Yes	1.3	Yes	Good				1
708	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.6	No	5.1	Yes	Good				0
709	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.0	No	6.3	Yes	Good		Driveway		0
710	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	1.3	Yes	0.9	Yes	Good				1
711	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	2.0	No	4.7	Yes	Good		Driveway		0
712	Owatonna	Yes	Yes	N/A	No	No	Yes	2.5	Yes	0.8	No	Good				0
713	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	1.4	Yes	1.0	Yes	Good				1
714	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	1.5	Yes	1.2	Yes	Good				1
715	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.2	Yes	1.0	Yes	Good				1
716	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.5	Yes	1.3	Yes	Good				1
717	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	1.1	Yes	2.0	Yes	Good				1
718	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.3	Yes	1.4	Yes	Good				1
719	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.9	No	2.9	Yes	Good		Driveway		0
720	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	1.4	Yes	2.0	Yes	Good				1
721	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	1.2	No	5.5	Yes	Good		Driveway		0
722	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.0	Yes	1.5	Yes	Good				1
723	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.8	No	3.6	Yes	Good		Driveway		0
724	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	1.3	Yes	1.4	Yes	Good				1
725	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	4.5	No	2.3	Yes	Good				0
726	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	2.5	Yes	1.0	Yes	Good				1
727	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	1.4	Yes	1.2	Yes	Good		Man hole		1
728	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	2.5	No	4.3	Yes	Good				0
729	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.9	Yes	0.8	Yes	Good				1
730	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	1.0	Yes	0.4	Yes	Good				1
731	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	3.3	Yes	1.3	Yes	Good		Low branches		1
732	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	2.1	Yes	0.4	Yes	Good				1
733	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	1.3	No	5.7	Yes	Good		Driveway		0
734	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.7	Yes	1.9	Yes	Good		Man hole		1
735	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	1.1	Yes	1.7	Yes	Fair	Ponding		One crack	1
736	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.0	No	3.2	Yes	Good		Driveway		0
737	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.4	Yes	0.6	Yes	Good				1
738	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	1.2	Yes	1.8	Yes	Fair	Ponding	Heavy sand accumulation	Heavy sand accumulation	0
739	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.0	Yes	1.0	Yes	Good				1

OBJECTID	City	Is the route stable and slip-resistant?	Is the route at least 48in wide?	If >200ft x <60in, is there 60"x60" passing space?	If grates or openings, openings <= 0.5in?	Long dim of grate opening perpendicular to direction travel?	Running slope <= 5% or slope of parallel roadway?	What is the running slope?	Is the cross slope no steeper than 2%?	SW_Cross_slope	Are there no gaps in elevations or distances between concrete panels > 1.5?	Sidewalk overall condition	Are there any obstructions or ponding?	Does the sidewalk have any other characteristics?	Notes	Compliant 1=Compliant
740	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.3	Yes	0.3	Yes	Fair	Ponding	Heavy sand accumulation	Heavy sand accumulation	0
741	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.4	Yes	0.7	Yes	Good				1
742	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.6	Yes	1.1	Yes	Good				1
743	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.2	Yes	0.7	Yes	Good				1
744	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.2	Yes	1.0	Yes	Good				1
745	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	1.1	Yes	1.2	Yes	Good				1
746	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	1.2	No	3.4	Yes	Fair		Some vegetation		0
747	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.4	Yes	1.0	Yes	Fair	Ponding			1
748	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.5	No	3.4	Yes	Good		Driveway		0
749	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.1	Yes	1.5	Yes	Fair	Ponding			1
750	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.5	No	3.5	Yes	Good		Low branches		0
751	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.6	Yes	1.2	Yes	Good				1
752	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	1.0	No	3.7	Yes	Fair				0
753	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.2	No	2.9	Yes	Good				0
754	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.5	Yes	1.1	Yes	Good				1
755	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.9	No	4.4	Yes	Good		Driveway		0
756	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.7	Yes	0.6	Yes	Good				1
757	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.2	Yes	0.6	Yes	Good				1
758	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	4.2	No	4.1	Yes	Fair	Ponding	Some cracking	Bump in sidewalk	0
759	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	1.2	Yes	0.9	Yes	Good		Man hole		1
760	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.1	Yes	0.4	Yes	Good				1
761	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.7	Yes	0.1	Yes	Good				1
762	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.3	Yes	0.3	Yes	Good				1
763	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.1	Yes	0.5	Yes	Good		Man hole	Sand under bridge	1
764	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	4.4	Yes	0.3	Yes	Fair	Ponding	Heavy sand accumulation	Heavy sand accumulation	0
765	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	2.2	Yes	0.8	Yes	Good			One bush in the way	1
766	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.0	Yes	1.3	Yes	Good				1
767	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	1.0	Yes	0.5	Yes	Good				1
768	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.4	Yes	1.0	Yes	Fair	Ponding	Some vegetation		1
769	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.7	No	2.9	Yes	Good		Driveway		0
770	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.3	Yes	0.1	Yes	Fair		Driveway	Rocky pavement	1
771	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	4.0	Yes	2.0	Yes	Fair		Ponding	Some rock from trail in sidewalk	1
772	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	4.0	No	3.0	Yes	Good				0
773	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	1.8	Yes	1.7	Yes	Good				1
774	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	1.9	No	2.3	Yes	Good				0
775	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.4	No	2.4	Yes	Good				0
776	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.9	Yes	0.7	Yes	Good				1
777	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.4	Yes	0.3	Yes	Good				1
778	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	1.2	Yes	1.0	Yes	Good				1
779	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.3	Yes	0.0	Yes	Good				1
780	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.1	Yes	0.2	Yes	Good				1
781	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	2.0	Yes	1.1	Yes	Good				1
782	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.5	Yes	0.9	Yes	Good				1
783	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	1.2	Yes	0.9	Yes	Good				1
784	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.3	Yes	1.7	Yes	Good				1
785	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.3	Yes	1.6	Yes	Good				1
786	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.4	No	2.2	Yes	Good				0
787	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	2.3	No	2.4	Yes	Good				0
788	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.3	No	4.6	Yes	Good		Driveway		0
789	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.3	Yes	1.1	Yes	Good				1
790	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.2	No	3.4	Yes	Good		Driveway		0
791	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.1	Yes	1.4	Yes	Good				1
792	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	1.2	Yes	1.2	Yes	Good				1
793	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.6	Yes	0.5	Yes	Good				1
794	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	1.7	Yes	0.9	Yes	Good				1
795	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.7	Yes	0.8	Yes	Good		Some cracking		1
796	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.7	Yes	0.4	Yes	Good		Some cracking	Small man hole	1
797	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.0	Yes	1.8	No	Fair		Some cracking	Gap in the cracks, small man hole	0
798	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.7	Yes	0.4	Yes	Good				1
799	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.6	No	3.6	Yes	Good		Driveway		0
800	Owatonna	Yes	Yes	N/A	N/A	N/A	Yes	0.5	Yes	1.1	Yes	Good				1

TOTAL:	609
# Compliant:	272
% Compliant:	45%

OBJECTID	City	Push button <= 5ft of outside edge of crosswalk?	Push button face oriented parallel w\ crosswalk?	4'x4' flat landing adjacent to each push button?	Push button btwn 1.5ft & 10ft from back of curb?	>= 10ft of separation between push buttons?	Push button mounted >=42in and <=48in?	Is a 4 foot PAR w/ 2% cross slope maintained?	Is there an audible walk indication?	Vibrotactile arrow present and correct dir?	Notes	Compliant 1=Compliant	County Signal ID
20	Owatonna	No	Yes	No	No	No	No	No	No	No		0	22
21	Owatonna	Yes	Yes	No	Yes	No	No	No	No	No		0	22
22	Owatonna	Yes	Yes	No	Yes	No	Yes	No	No	No		0	22
23	Owatonna	Yes	Yes	No	Yes	No	Yes	No	No	No		0	22
24	Owatonna	Yes	Yes	Yes	Yes	N/A	Yes	Yes	No	Yes		0	21
25	Owatonna	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Very quiet	1	21
27	Owatonna	Yes	Yes	Yes	Yes	N/A	Yes	Yes	No	Yes		0	21
28	Owatonna	Yes	Yes	No	Yes	N/A	Yes	No	No	No		0	16
29	Owatonna	Yes	Yes	Yes	Yes	N/A	Yes	Yes	No	No	Crack/ gap in elevation	0	16
30	Owatonna	Yes	Yes	No	Yes	N/A	Yes	No	No	No		0	15
31	Owatonna	Yes	Yes	No	Yes	N/A	Yes	No	No	No		0	15
34	Owatonna	Yes	Yes	Yes	Yes	N/A	Yes	No	No	No	Gap in elevation	0	15
35	Owatonna	Yes	Yes	No	Yes	N/A	Yes	No	No	No	Flat landing but fire hydrant	0	15
36	Owatonna	Yes	Yes	Yes	No	N/A	Yes	No	No	No		0	16
37	Owatonna	Yes	Yes	No	Yes	N/A	Yes	Yes	No	No		0	16
38	Owatonna	Yes	Yes	No	Yes	Yes	Yes	No	Yes	Yes	Quiet	0	4
39	Owatonna	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Yes	West Leg never shows walking symbol	1	4
40	Owatonna	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Yes	West Leg never shows walking symbol , South Leg never shows walking symbol	1	4
41	Owatonna	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Yes	South Leg never shows walking symbol	1	4
42	Owatonna	Yes	Yes	Yes	Yes	N/A	Yes	Yes	Yes	Yes	Sign not visible	1	2
43	Owatonna	Yes	Yes	Yes	Yes	Yes	Yes	Yes	No	Yes	Both don't speak, no visible sign on one	0	2
44	Owatonna	Yes	Yes	Yes	Yes	N/A	Yes	Yes	No	Yes	Sign not visible	0	2
48	Owatonna	Yes	Yes	No	Yes	N/A	Yes	No	No	No		0	17
49	Owatonna	Yes	Yes	No	Yes	N/A	Yes	No	No	No		0	17
50	Owatonna	Yes	Yes	No	Yes	N/A	Yes	No	No	No		0	17
51	Owatonna	Yes	Yes	No	Yes	N/A	Yes	No	No	No		0	17
53	Owatonna	No	Yes	No	No	N/A	Yes	No	No	No		0	18
54	Owatonna	Yes	Yes	No	Yes	N/A	No	No	No	No		0	18
55	Owatonna	Yes	Yes	No	Yes	N/A	Yes	No	No	No		0	19
56	Owatonna	Yes	Yes	No	Yes	Yes	Yes	No	No	No		0	19
57	Owatonna	Yes	Yes	No	Yes	N/A	Yes	No	No	No		0	19
58	Owatonna	Yes	Yes	No	Yes	N/A	Yes	No	No	No		0	19
59	Owatonna	Yes	Yes	No	Yes	N/A	No	No	No	No		0	18
60	Owatonna	Yes	Yes	No	Yes	N/A	Yes	No	No	No		0	18
61	Owatonna	Yes	Yes	No	Yes	N/A	Yes	No	No	No		0	8
62	Owatonna	Yes	Yes	No	Yes	N/A	Yes	No	No	No		0	8
63	Owatonna	Yes	No	No	Yes	N/A	No	No	No	No	In a fence	0	8
64	Owatonna	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Yes		1	9
65	Owatonna	Yes	Yes	No	Yes	Yes	Yes	No	Yes	Yes		0	9
66	Owatonna	Yes	Yes	No	Yes	N/A	Yes	No	No	No		0	8
67	Owatonna	Yes	Yes	Yes	Yes	No	Yes	Yes	Yes	Yes		0	9
68	Owatonna	Yes	Yes	Yes	Yes	No	Yes	Yes	Yes	Yes		0	9
69	Owatonna	Yes	Yes	No	Yes	N/A	Yes	Yes	No	No		0	7
70	Owatonna	Yes	Yes	No	Yes	N/A	Yes	No	No	No		0	7
71	Owatonna	Yes	Yes	No	Yes	N/A	Yes	No	No	No		0	7
72	Owatonna	Yes	Yes	No	Yes	N/A	Yes	No	No	No		0	7
73	Owatonna	Yes	Yes	No	Yes	N/A	Yes	No	No	No		0	6
74	Owatonna	Yes	Yes	No	Yes	N/A	Yes	No	No	No		0	6
75	Owatonna	Yes	Yes	No	Yes	N/A	No	No	No	No		0	6
76	Owatonna	Yes	Yes	No	Yes	N/A	No	No	No	No		0	6
77	Owatonna	Yes	Yes	Yes	Yes	N/A	Yes	Yes	Yes	Yes		1	5
78	Owatonna	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Yes		1	5
79	Owatonna	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Yes	Yes		1	5
80	Owatonna	Yes	Yes	Yes	Yes	N/A	Yes	Yes	Yes	Yes		1	5

TOTAL:	54
# Compliant:	10
% Compliant:	19%